

Service Bulletin

Circolare Tecnica - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 2 December 2013

Subject: **Tilt Sensor**

Product: **B3 675 - 800**

We inform you that it is necessary to install 2 washers in order to ensure the correct installation of the tilt sensor. These improvements are the result of the continuous quality control of our motorcycles.

It is mandatory to install the update on the interested motorcycles before consignment to the customer.

Updates are necessary on the following bikes:

- **MODELS B3 675-800 from VIN ...V000001 up to VIN ...V004517 included**

MATERIALS TO BE ORDERED FOR THE UPDATE:

- N° 2 items Part Number 62ND15548 WASHER

PROCEDURE TO IMPLIMENT THE UPDATE:

- 1) remove seat
 - 2) loosen the 2 screws that fix the tilt sensor
 - 3) Insert under the sensor, in correspondence with the fixation holes, the 2 washers Part Number 62ND15548.
 - 4) Tighten the 2 screws to a torque of 3 N/m
 - 5) reinstall the seat
- Please refer to the Service Manual for any information not included in this document.
- Test the motorcycle before consignment to the customer.

Procedure for Warranty reimbursement:

Send a Warranty Request for reimbursement of the parts and labor including all the relevant information regarding the motorcycle and parts with the following codes:

- Warranty Type = GS
- Special Warranty Code = 2785
- Operation Code: V - 999
- Labor: 0,2 hours
- Defect Code: 099

Please make note to this same communication.

The reimbursement of the warranty request will be carried out via Invoice as is the normal procedure.

Thank you in advance for your cooperation, for any need we advice you to contact the MV Agusta Service Dept.

Best Regards,
MV AGUSTA MOTOR S.p.A.
Technical Service Department