

Service Bulletin

Circolare Tecnica - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 22 November 2013

Subject: **Licence plate support**

Product: **Brutale 1090 – Brutale 1090 R – Brutale 1090 RR - MY 2013 - 14**

We inform you that it is necessary to install a new licence plate holder P/N 8A00B9192 on the B4 MY 2013-14. These improvements are the result of the continuous quality control of our motorcycles.

It is mandatory to install the update on the interested motorcycles before consignment to the customer.

Updates are necessary on the following bikes:



- **MODEL B4 – R – RR MY 2013-14 from VINV004516 up to VINV005686 included**

MATERIALS TO BE ORDERED FOR THE UPDATE:

- N° 1 Part Number 8A00B9192 LICENCE PLATE SUPPORT

PROCEDURE TO IMPLIMENT THE UPDATE:

- 1) Remove rider's seat - passenger's seat (B4 RR)
- 2) Dismount and move away from its housing the relay and fuse box support bracket.
- 3) Disconnect turn indicators cables and plate light cables
- 4) Remove and displace from it's housing the seat key lock – passenger's seat (B4 RR)
- 5) Remove the 3 fixing screws from the licence plate support
- 6) Remove the licence plate support by gently pulling the cables through the dedicated hole in the inner rear mudguard
- 7) Remove turn indicators and the licence plate light from the licence plate support
- 8) Take the new licence plate support

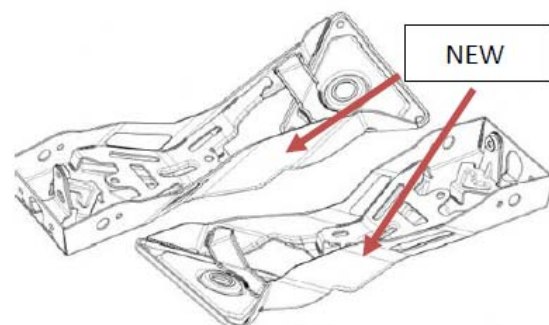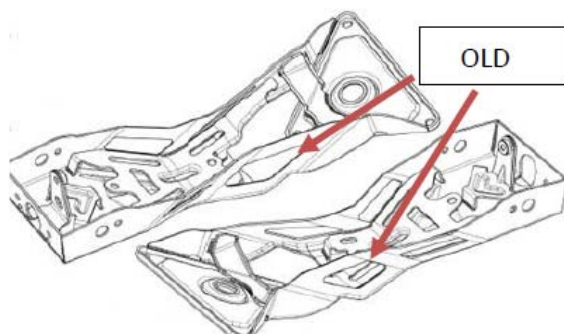

9) install the new licence plate support by performing the operations described above in reverse order

Please refer to the Service Manual for any information not included in this document.
Test the motorcycle before consignment to the customer.
For any need we advice you to contact the MV Agusta Service Dept.

Procedure for Warranty reimbursement:

Send a Warranty Request for reimbursement of the parts and labor including all the relevant information regarding the motorcycle and parts with the following codes:

- Warranty Type = GS
- Special Warranty Code = 2783
- Operation Code: R - 999
- Labor: 0,4 hours
- Defect Code: 099

Make note to the Service Bulletin N° 119

The reimbursement of the warranty request will be carried out via Invoice as is the normal procedure.

Thank you in advance for your cooperation.

Best Regards
MV AGUSTA MOTOR S.p.A.
Technical Service Department