

Service Bulletin

Circolare Tecnica - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 4 November 2013

Subject: **Key Switch W000W1037 2nd update**

Product: **F4 - F4 R - F4 RR - MY 2013**

We inform you that it is necessary to replace the electrical part of the key switch on the F4 MY 2013. These improvements are the result of the continuous quality control of our motorcycles.

It is mandatory to install the updates on the interested motorcycles before consignment to the customer.

Updates are necessary on the following bikes:

- **MODEL F4 - R - RR MY 2013 from VINV003401 up to VINV004198 included**

Materials to be ordered for the update:

- N° 1 part number W000W1037 PARTE ELETTRICA ZADI

- **PROCEDURE TO IMPLIMENT THE UPDATES:**

Key switch update:

- Remove the windshield



- Remove the 3 fairing fixing screws on both Right and Left fairings as shown in figure.



- Remove the Right and Left covers by unscrewing the 2 fixing screws and pulling gently the side fairing in order to facilitate the extraction. **Reconnect** the side fairings in order to avoid any interference with the handlebar during the operation.




- Remove the little cover under the key switch by loosening the 2 fixing screws.



- Disconnect the two clips that are fixing the key switch's electrical part.



- Remove the Key Switch.

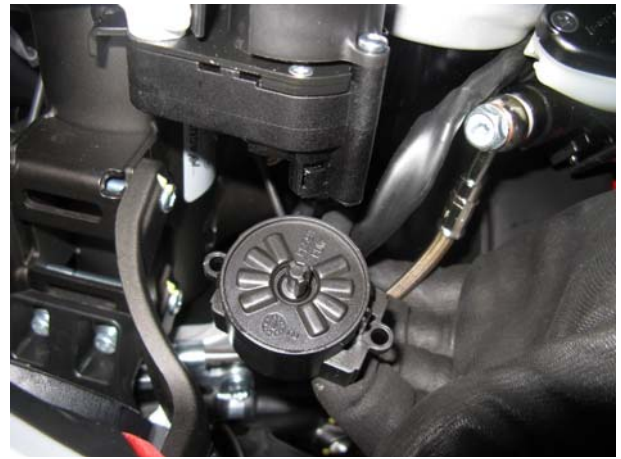

- Remove the white connector as shown in figure.



- Disconnect the key switch connector



- Now remove the Key Switch, to facilitate the operation we recommend to identify the key switch cable on the right side of the steering column and cut it.



- Take the new key switch part number W00W1037 "PARTE ELETTRICA ZADI" identified by the label as shown in figure and proceed with the installation of the component by inverting the disassembly operations previously described.

- If necessary turn the key in order to find the correct timing..



- Position the key switch cable between the airbox and the connectors group



- Insert the key switch in place and fix the cover with the 2 screws previously removed.
- Reassemble the motorcycle completely.
- Please refer to the Service Manual for any information not included in this document.

Test the motorcycle before consignment to the customer.

For any need we advice you to contact the MV Agusta Service Dept.

Procedure for Warranty reimbursement:

Send a Warranty Request for reimbursement of the parts and labor including all the relevant information regarding the motorcycle and parts with the following codes:

- Warranty Type = GS
- Special Warranty Code = 2775
- Operation Code: T 999
- Labor: 0,5 hours
- Defect Code: 099

In the commentary make note to the Service Bulletin N°117.

The reimbursement of the warranty request will be carried out via Invoice as is the normal procedure.

Thank you in advance for your cooperation

Best Regards,
MV AGUSTA MOTOR S.p.A.
Technical service Department