

Service Bulletin

Circolare Tecnica - Technisches Rundschreiben - Circulaire Technique - Circular Tecnica

Date: 25 June 2013

Subject: **QUICK SHIFT screw replacement**

Product: **F4 - F4 R - F4 RR - MY 2013**

After a continuous product quality monitoring, we found a possible irregularity in the functioning of the EAS system, caused by an interference of the screw with the sensor, it is therefore necessary to replace the EAS sensor and shift lever fixing screw.

It is therefore necessary to operate on the following VIN numbers:

- **MODEL F4 - R - RR MY 2013 from VIN ..DV003401 up to VINV003977 included**

Materials to be ordered for the update:

- N° 1 item, part number 8000B8930 Special Screw

- **PROCEDURE TO IMPLIMENT THE UPDATE:**

- remove the EAS sensor-shift lever fixing screw mounted on the motorcycle

- pick up the new screw part number 8000B8930


- insert the new screw in the EAS sensor, as shown in figure.



- Apply a layer of Loctite 243 thread lock in the first screw threads, taking care not to cover the EAS sensor area.



- Tighten the screw to a 7-8 Nm torque

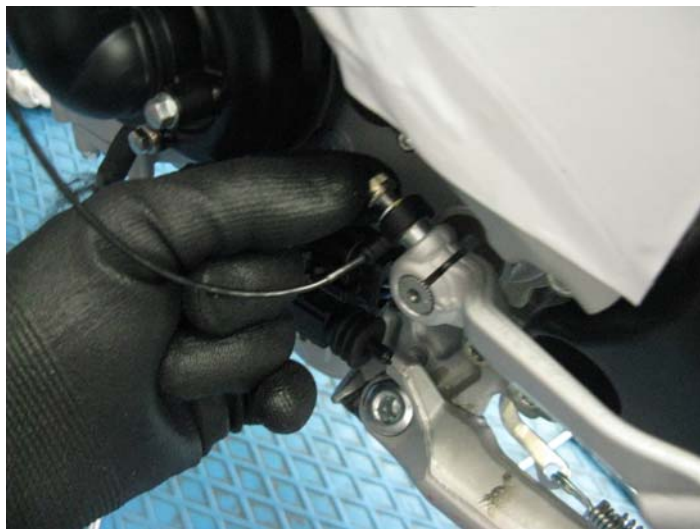

- Please refer to the Service Manual for any information not included in this document.
- Test the motorcycle before consignment to the customer, in order to verify the correct functioning.

Procedure for Warranty reimbursement:

Send a Warranty Request for reimbursement of the parts and labor including all the relevant information regarding the motorcycle and parts with the following codes:

- Warranty Type = GS
- Special Warranty Code = 2779
- Operation Code: F - 999
- Labor: 0,3 hours
- Defect Code: 099

Please make note to the Service Bulletin N°110.

The reimbursement of the warranty request will be carried out via Invoice as is the normal procedure.

Thank you in advance for your cooperation, we remain at your disposal for any technical/commercial support.

Best Regards,
MV AGUSTA MOTOR S.p.A.
Technical Service Department