

TECHNICAL BULLETIN  
LTB00530NAS1  
08 MAR 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**SECTION: 501-10**

'Creak' Noise From Front Seat Base

**AFFECTED VEHICLE RANGE:**

<b>LR2 (LF)</b>	<b>Model Year:</b>	<b>2010-2012</b>
	<b>VIN:</b>	<b>AH148520-CH272954</b>
<b>LR4 (LA)</b>	<b>Model Year:</b>	<b>2010-2012</b>
	<b>VIN:</b>	<b>AA510178-CA601050</b>
<b>Range Rover Sport (LS)</b>	<b>Model Year:</b>	<b>2010-2012</b>
	<b>VIN:</b>	<b>AA304246-CA722211</b>

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** A 'creak' noise may be heard when sitting on the seat cushion.

**Cause:** This may be caused by insufficient lubrication at the seat pivot point.

**Action:** In the event of a customer concern of the above, refer to the Repair Procedure outlined below.

**PARTS:**



**NOTE:** To be sourced from the Squeaks & Rattles kit; refer to Technical Bulletin LTB00389NAS for more information

Nyogel 774L

Quantity: 1

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:**



**NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIX to obtain the latest repair time.



**NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART

Seat cushion - front seat - remove for access and reinstall - right front seat cushion - LR2	<b>78.10.12.99</b>	0.10	42	LR017006
Seat cushion - front seat - remove for access and reinstall - left front seat cushion - LR2	<b>78.10.12.99</b>	0.10	42	LR017008
Seat cushion - front seat - remove for access and reinstall - right front seat cushion - LR4, Range Rover Sport	<b>78.10.12.99</b>	0.20	42	LR017006
Seat cushion - front seat - remove for access and reinstall - left front seat cushion - LR4, Range Rover Sport	<b>78.10.12.99</b>	0.20	42	LR017008



**NOTE: Normal Warranty policies and procedures apply.**

### **REPAIR PROCEDURE:**

1.  **NOTE: Make sure the customer concern is a 'creak' noise; if it is a seat 'rock' concern, refer to Technical Bulletin LTB00176NAS.**

Remove the affected seat lower cushion (TOPIx Workshop Manual section 501-10).

2. Lubricate the seat pivot point as shown using Nyogel 744L from the Squeaks & Rattles Kit.



3. Install the seat lower cushion (TOPIx Workshop Manual section 501-10).