

Jaguar Oxygen Sensor date code identification.pdf

Reference	SSM65997
Models	XF / X250 XJ / X351 F-TYPE / X152
Title	Oxygen sensor DTC`s
Category	Driveability
Last modified	12-Jun-2013 00:00:00
Symptom	698298 Malfunction Indicator Lamp
Content	<p><u>Issue:</u> Check Engine warning Light illuminated. DTC's in the Engine Control Module relevant to the Oxygen Sensor are found to be stored, these may include any of the following codes: P0042, P0043, P0055, P0061, P0062, P0063, P0142, P0144, P0162.</p> <p><u>Cause:</u> Manufacturing fault at the Supplier - misalignment within the Sensor leading to side load on the Ceramic internal to the Sensor. This pre-stress, in combination with normal Vehicle use leads to premature Component malfunction.</p> <p><u>Action:</u> If the above issue is verified, before fitting the new Oxygen Sensor(s) please check the date code stamped on the body of the Sensor and ensure it reads 1st March 2013 or later (see attachment for guidance). Part numbers affected are - F-Type: C2D28856 - Left hand & right hand Mid Oxygen Sensor C2D23703 - Left hand & right hand rear Oxygen Sensor</p> <p>XF/XJ 2WD: C2D23702 - Left hand & right hand Mid Oxygen Sensor C2D23703 - Left hand & right hand rear Oxygen Sensor</p> <p>XF/XJ AWD: C2D27350 - Left hand & right hand Mid Oxygen Sensor C2D24758 - Left hand & right hand rear Oxygen Sensor</p> <p>All Vehicles built from the following VIN's have the revised Sensors fitted: F-Type - K03002 XF - S95518 XJ - V54626</p> <p>NOTE IMPORTANT - If a Vehicle is identified post the assure VIN's, please take a Photograph of the date code stamped on th Body of the Sensor, and raise an ePQR. Please also retain the old Sensor as it will be required by Engineering for analysis.</p>