Tech Tips




Das Auto.

Date: January 18, 2013

2008-2014 Vehicles with CCTA or CBFA 2.0T TSI Engine – Crank Gear/Timing Chain Service Tip

December 5, 2014: Update to model year.

When servicing the timing chain sprocket or removing the vibration damper, be aware that one bolt holds both the vibration damper (harmonic balancer) and the crankshaft timing chain sprocket to the crankshaft. Once the damper is removed, the crankshaft should not be rotated unless special tool spacer T10368 has been installed. The crankshaft timing chain sprocket and spur gear drive on the crankshaft have a coupling that must be seated correctly during assembly. Failure to install special tool spacer T10368 before rotating engine will cause the engine to skip time and bend valves.

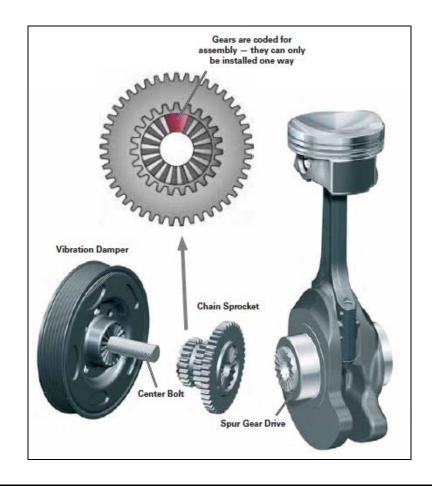

© 2014 Volkswagen Group of America, Inc.

ver1.2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.