



Technical Bulletin

Model(s)	Year	Engine Code	Trans. Code	From	To
Jetta (Except Hybrid)	2012	All	All	AJ_CM000132	AJ_CM133019
	2012	All	All	AJ_CM300030	AJ_CM473994
	2013	All	All	AJ_DM212000	AJ_DM223599
Jetta Sportwagen	2012	All	All	AJ_CM600055	AJ_CM714823
	2013	All	All	AJ_DM600610	AJ_DM632613
Beetle	2012	All	All	AT_CM608714	AT_CM666411
	2013	All	All	AT_DM605301	AT_DM630841
Golf/GTI	2012	All	All	AJ_CW000164	AJ_CW355364
	2013	All	All	AJ_DW014773	AJ_DW076186
Eos	2012	All	All	AH_CV000010	AH_CV022692
	2013	All	All	AH_DV000129	AH_DV002843
Passat	2012	All	All	A3_CC000237	A3_CC111168
	2013	All	All	A3_DC000133	A3_DC027988
CC	2012	All	All	AN_CE500020	AN_CE553133
	2013	All	All	AN_DE517090	AN_DE534178
Tiguan	2012	All	All	AX_CW000602	AX_CW611172
	2013	All	All	AX_DW000363	AX_DW542347

Condition

91 13 03 January 11, 2013 2031136

Update programming RCD-510 Radio (Premium 8)



Note:

All models except Routan, Touareg, and Jetta Hybrid.

This update programming has been released to address the following customer complaints.

If a customer states:

“Bluetooth audio runs in mono”.

“Media player automatically starts when phone is connected to vehicle.”

“Bluetooth audio level is too high”.

Technical Bulletin

Technical Background

Programming contained in software level(s) 0007, 0008, 0009, 0010, 0011, 0012, 0013, 0014, 0015, 0016 for certain RCD-510 Radio (Premium 8) radios may cause Bluetooth audio quality complaints for model year 2012 (**SVM 383F**).

Programming contained in software level 0007 for certain RCD-510 Radio (Premium 8) radios may cause Bluetooth audio quality complaints for model year 2013 (**SVM 37DC**).

Production Solution

Model Year 2012 and 2013 running software change.

Service

Procedure



Note:

This software update may take up to two hours to complete.

DO NOT diagnose or replace any parts **before** performing the update function as explained in this bulletin.



Tip:

To Update-Programming using SVM, review and follow instructions in Technical Bulletin Instance 2014603 "Software Version Management".

The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim.



Note

Prior to launching VAS-PC application and starting radio update process, confirm tester screen saver and power settings in accordance with Special Tools and Equipment - Service Information Circular # VVT-12-02. Failure to do so may result in the tester entering power save mode during data transfer, and subsequent control module failure.

When using a VAS 6150/5051B or VAS 5052A tester in conjunction with a VAS 5054A wireless transmitter head for a flash procedure, please connect a USB cable between the transmitter head and the tester. Failure to do so may lead to errors during the flash procedure. VAS tools must only be used with their power adapters plugged in. Under no circumstances should they be used on battery power alone during the programming procedure.

Ensure that a battery maintainer is connected to the vehicle during programming. Failure to do so WILL CAUSE IRREVERSIBLE DAMAGE.

Technical Bulletin



- Switch ignition ON.
- On the radio, hold “setup” button <arrow> for 3 to 5 seconds.
- “Radio service mode” will display <as shown>.



- On screen, press “Version Info” <arrow>.

Technical Bulletin

i Tip:

Radio part number and software indexes may be one of the following:



i Tip:

2012 vehicles, software 383F

- Verify current part number is **1K0-035-180-AE** <circle>.
- Verify current SW index is one of the following software levels: 0007, 0008, 0009, 0010, 0011, 0012, 0013, 0014, 0015, 0016 <arrow>.



i Tip:

2013 vehicles, software 37DC

- Verify current part number is **1K0-035-180-AF** <circle>.
- Verify current SW index is "0007" <arrow>.

Technical Bulletin



Note:


Ensure that a battery maintainer is connected to the vehicle during programming. Failure to do so WILL CAUSE IRREVERSIBLE DAMAGE.

- Select Guided Functions




- Select model

Technical Bulletin

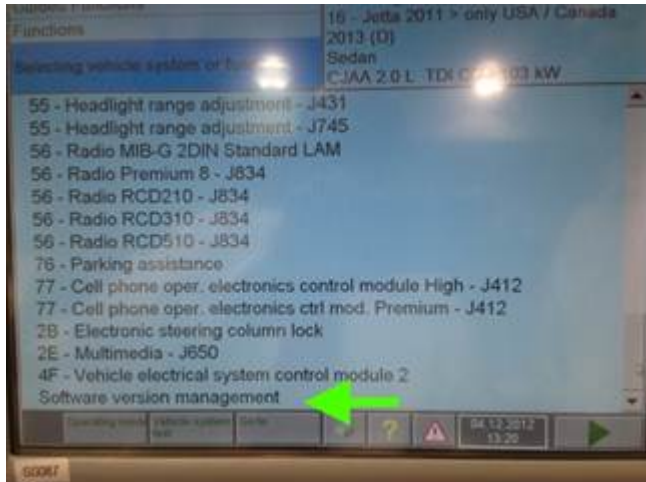


- Select, “Software version Management”.

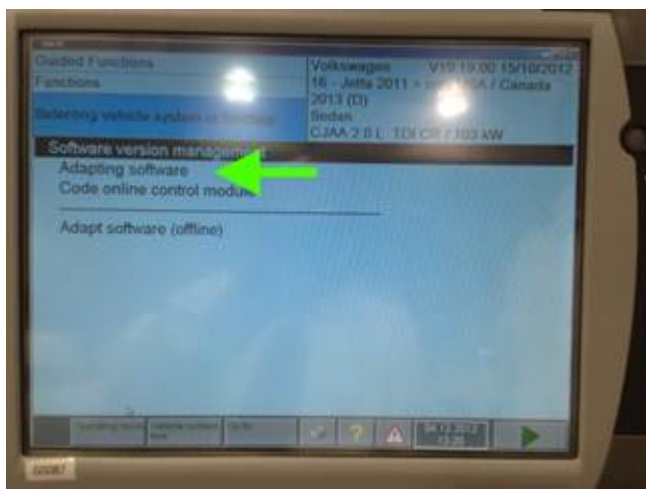


- Select, “Adapting software”.

Technical Bulletin

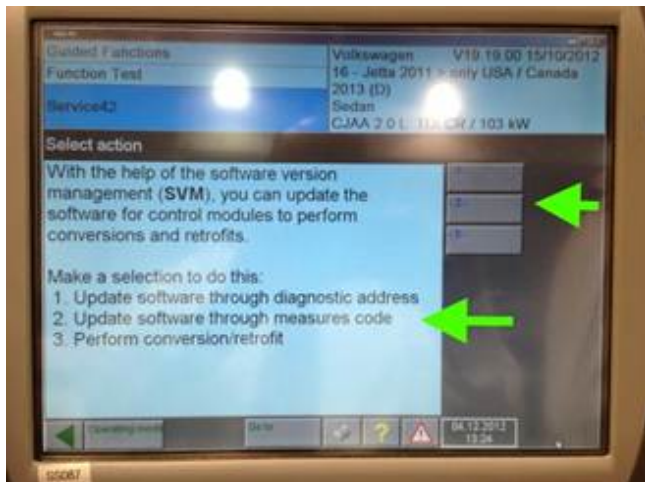

- “Update software through measures code”.
- Press forward arrow.

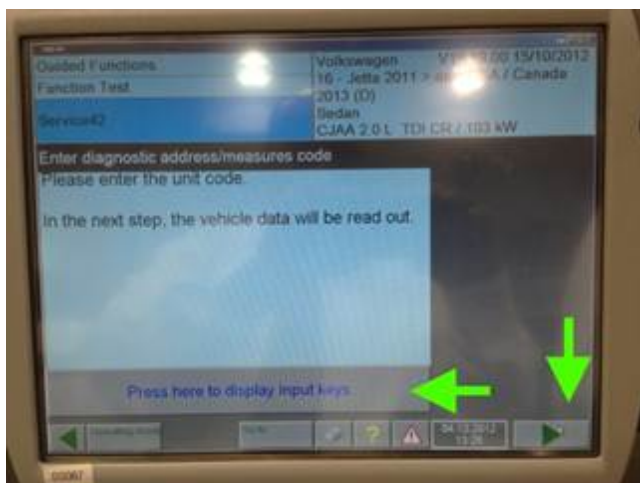


- Input software code, “383F” for 2012 vehicles only.
- Input software code, “37DC” for 2013 vehicles only.
- Press forward arrow.

Technical Bulletin




- Select done.
- Insert, Geko ID”.

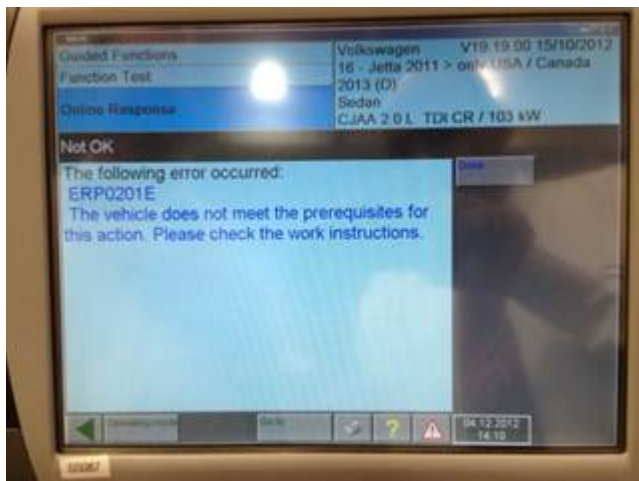

- Wrong radio used will display the following error code.


Technical Bulletin

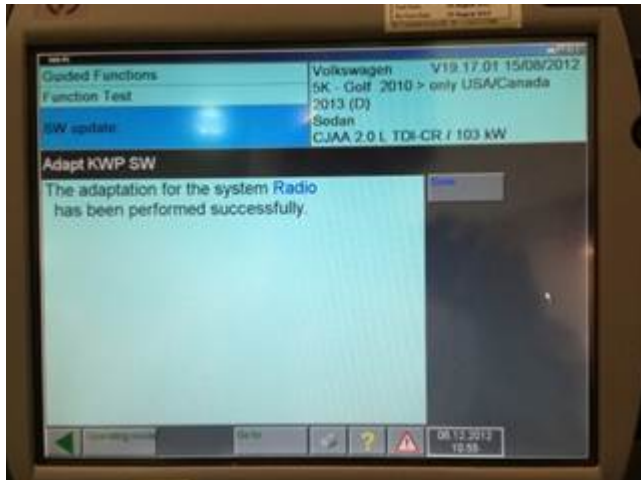

Note:


This software update may take up to two hours to complete.

- After the software update is complete the screen should state performed successfully.
- Press the done button.

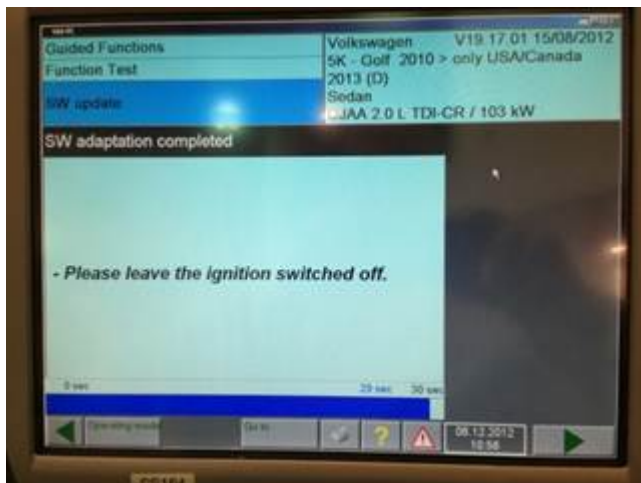


- After pressing the done button you must switch ignition OFF for thirty seconds.

Technical Bulletin

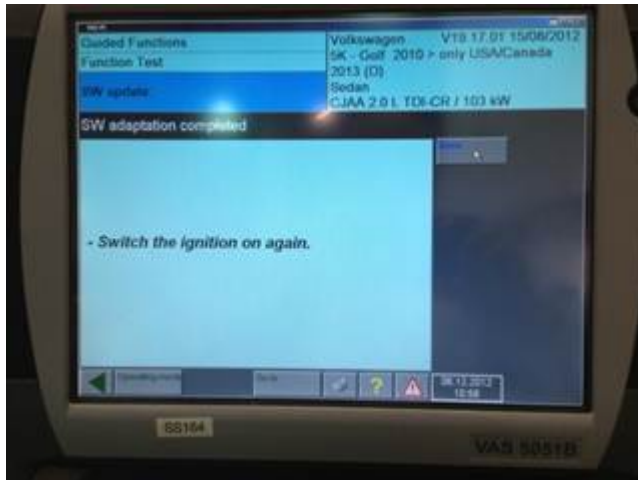

- Scan tool will prompt to switch ignition ON.

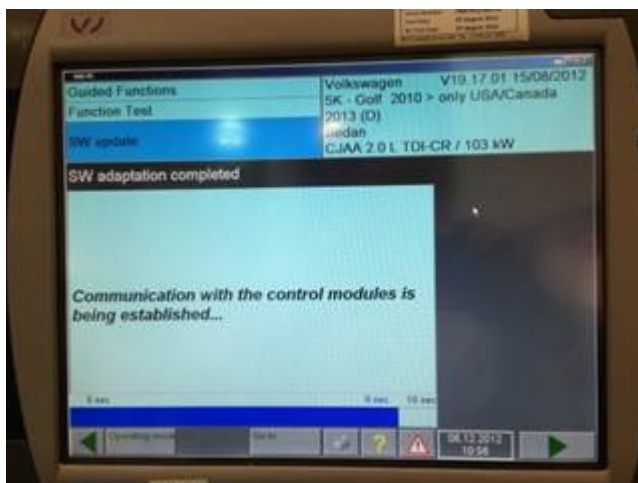


- Communication will re-establish with vehicle.

Technical Bulletin



- Scan tool will erase event memory.

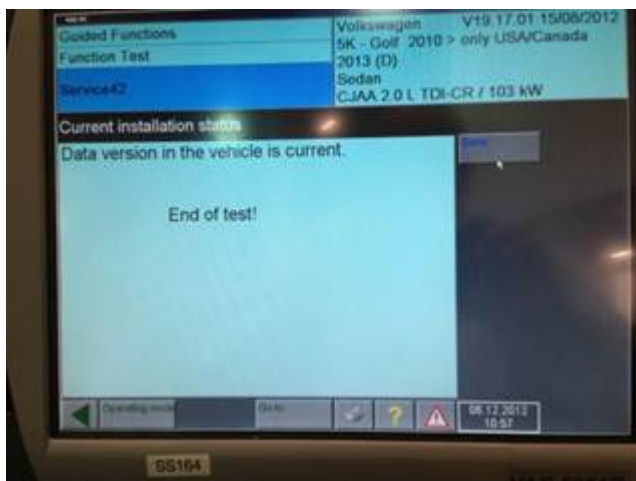

- When update is complete the screen will state, "end of test".

Technical Bulletin



- Press and Hold the “Setup” button for 3 to 5 seconds.
- Verify new “SW index” is “0008” as shown <arrow>.

Model Year	Model	Old Software Part No.	Old Software Version	New Software Part No. New	New Software Version	SVM Action Code
2012	All models (except Routan, Touareg, and Jetta Hybrid)	1K0.035.180.AE	0007, 0008, 0009, 0010, 0011, 0012, 0013, 0014, 0015, 0016	1K0.035.180.AF	0008	383F
2013		1K0.035.180.AF	0007	1K0.035.180.AF	0008	37DC



Technical Bulletin

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Jetta (Except Hybrid)	2012	All	All	AJ_CM000132	AJ_CM133019
	2012	All	All	AJ_CM300030	AJ_CM473994
	2013	All	All	AJ_DM212000	AJ_DM223599
Jetta Sportwagen	2012	All	All	AJ_CM600055	AJ_CM714823
	2013	All	All	AJ_DM600610	AJ_DM632613
Beetle	2012	All	All	AT_CM608714	AT_CM666411
	2013	All	All	AT_DM605301	AT_DM630841
Golf/GTI	2012	All	All	AJ_CW000164	AJ_CW355364
	2013	All	All	AJ_DW014773	AJ_DW076186
Eos	2012	All	All	AH_CV000010	AH_CV022692
	2013	All	All	AH_DV000129	AH_DV002843
Passat	2012	All	All	A3_CC000237	A3_CC111168
	2013	All	All	A3_DC000133	A3_DC027988
CC	2012	All	All	AN_CE500020	AN_CE553133
	2013	All	All	AN_DE517090	AN_DE534178
Tiguan	2012	All	All	AX_CW000602	AX_CW611172
	2013	All	All	AX_DW000363	AX_DW542347
SAGA Coding					
Claim Type:		Use applicable Claim Type ¹⁾			
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)		
9130	0039	--	Use applicable when indicated in ElsaWeb (L/R)		



Technical Bulletin

Parts Manufacturer		DE2 ²⁾
Labor Operation ³⁾ : Check/UPDATE present. No further work required.	91300099 - 10 TU	
Labor Operation ³⁾ : Update programming (Premium 8) Radio RCD-510	91302599 - 200 TU max.	
Causal Part: Select labor operation	9130****	
Diagnostic Time ⁴⁾		
GFF Time expenditure	01500000 = 00 TU max.	NO
Road Test	01210002 = 10 TU 01210004 = 10 TU	NO
Technical Diagnosis	01320000 = 00 TU max.	NO
Claim Comment: Input "As per Technical Bulletin 2031136" in comment section of Warranty Claim.		
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates. ⁴⁾ Documentation required per Warranty Policies and Procedures Manual.		

Required Parts and Tools

No special parts required.

Tool Description	Tool No:
VAS Diagnostic Tool	VAS-PC, 5051B, 5052A, 6150X (Base CD V19.01.00 and Brand DVD V19.19.00 or higher)
Midtronics Battery Tester/Charger	InCharge 940 (INC-940)

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.