## Das Auto.

## **Tech Tips**

TT 69-13-02

Date: March 15, 2013

2011-2013 Jetta Sedan, 2012-2013 Beetle, Passat – Unable To Complete Basic Settings After J706 Passenger Occupant Detection System (PODS) Module Replacement, Faults B1022F0, B102254

If Passenger Occupant Detection System (PODS) basic settings will not complete after module replacement, start by checking coax connector for fleece mat at module. Ensure coax cable is completely seated in connector housing and connector is properly seated in module.

If coax connector is properly installed, check seat cover and padding for moisture. If moisture is found, completely dry all components of seat, and then retry basic settings test plan.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.