A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the <u>Elsa Newsletter</u> section in the Technician References menu.

VW Elsa Newsletter



Das Auto.

Edition 58: October 21, 2013

Content

- <u>Technician Advisory</u> <u>Board</u>
- ODIS Software Versions
- <u>Technical Bulletins</u>
- <u>Pending Service</u>
 <u>Solutions</u>
- <u>Tech Tips</u>
- <u>Campaigns</u>
- <u>Updates</u>
- <u>Suggestions</u>



Technician Advisory Board

Technicians are at the core of VWGoA's Fix it Right the First Time (FRFT) initiatives. The challenges that Technicians face as the result of shortcomings in our Shared Service Processes are difficult and directly Impact FRFT efforts.

In an effort to overcome these challenges, we would encourage you to get to know the people of the Technician Advisory Board (TAB).

TAB is an Enhanced Service Communication and Feedback Strategy that allows all dealership

technicians to identify shortcomings in the Shared Service Processes and provide direct, unfiltered feedback by means of a multi-dealer, multi-directional path between technicians and VWGoA. This feedback is used to gain insight and correct real world issues that affect technician efficiency and undermine FRFT.

More information concerning the TAB group and a contact list can be found in <u>VSS-13-03 on</u> <u>ServiceNet.</u>

Back to top

ODIS Software Versions

Offboard Diagnostic Information System Service (ODIS Service) Base and Brand Versions)

Note: You can check the version number under Info > Versions

Current Base Version 2.0.0-1

Current VW Brand Version 1924.3068

Back to top

Technical Bulletins

69 13 05 - 2035369 Airbag Warning Lamp ON, DTCs B200009, B200049 or U101200 Stored in Airbag Control Unit					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta GLI, Passat	2012–2014	All	All	All	ALI
	t causing the c situation occu	airbag light urs, the airb	to illuminate	in the instrumer mains operation	it panel.

Pending Service Solutions

No new pending service solutions this week.

Back to top

Tech Tips

57-12-02TT - Alarm Goes Off When Unlocking Door With Key Cylinder - October 18, 2013: Update to Information					
Model(s)	Year	Eng. Code	Trans. Code		
Tourag	2004–2010	All	All		
Phaeton	2004–2006	All	All		

If the vehicle is entered using the door key, the alarm may activate when opening the door. The door lock cylinder does not disarm the alarm. The lock cylinder in the door is meant to be used as an emergency entry, therefore the key must be inserted into the ignition within 15 - 30 seconds of opening the door (dependent on vehicle and equipment), in order to disarm the alarm.

57-12-03TT - Remote Loses Programming - October 18, 2013: Update to information.				
Model(s)	Year	Eng. Code	Trans. Code	
Passat	2011–2013	All	All	
EOS, Jetta, Jetta Sport Wagen, Golf/GTI, Passat, Tiguan	2012	All	All	

Fault code 00955 005 or 00956 005 may be set in the Vehicle Electrical System Control Module - J519 - if the remote key fob is depressed repeatedly, or a button is held down. Customer may complain the remote no longer operates. To reset, remove the cover over the lock on the driver's door handle, cycle the key to lock, and then back to unlock. This should synchronize the remote and allow operation. Clear the fault and retest operation.

57-1	2-04TT - Remote Ur	lock for All Door	Unlock
Model(s)	Year	Eng. Code	Trans. Code
Jetta, Passa	2002–2005	All	All
unlocks on the first	he unlock button on attempt, perform a c n to unlock the other	apacitive discharge	e. The second press of

Back to top

Campaigns

No new campaigns this week

Back to top

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: www.workshopinformation@vw.com

Back to top

© 2013 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.