A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the <u>ElsaWeb</u> <u>Newsletter</u> section in the Technician References menu.

VW ElsaWeb Newsletter



Das Auto.

Edition 44: July 15, 2013

Content

- Feedback Corner
- <u>Technical Bulletins</u>
- <u>Pending Service</u>
 <u>Solutions</u>
- <u>Tech Tips</u>
- <u>Campaigns</u>
- <u>Updates</u>
- <u>Suggestions</u>



Feedback Corner

This week's feedback is from Josef regarding the 2009 Routan Repair Manual. He states:

"At the end of the test plan, it tells you what to do if 'yes' or 'no' and under 'yes', it says 'With the scan tool, select FCM under ECU selection then Miscellaneous Functions and restore vehicle configuration.' However, there is no restore Vehicle Configuration under the new wiTECH."

This feedback was reviewed by the Service Information team and changes were made to Elsa to resolve this issue. We really appreciate Josef sending in feedback to help improve the quality of the repair information.

Feedback Status			
New	Completed	To Factory	
11	10	0	

*Please note that this feedback feature is not the place to obtain technical assistance on Volkswagen vehicles or to report potential issues you may have experienced with a vehicle. If you require assistance in repairing or diagnosing a vehicle issue or wish to report a technical issue, please create a Volkswagen Technical Assistance ticket and contact the Volkswagen Technical Helpline at (800) 678-2389.

Back to top

Technical Bulletins

No new technical bulletins this week.

Pending Service Solutions

No new pending service solutions this week.

Back to top

Tech Tips

91-13-06 TT - Equipped with RCD-510 Premium 8 Radio – Radio Switches to Bluetooth Audio without Input			
Model(s)	Year	Eng. Code	Trans. Code

(viodei(s)	Tear	Ling. Code	Irans. Code
Golf, GTI, Eos, Jetta, Jetta Sportwagen, Passat, Tiguan	2010–2013	All	All
Beetle	2012–2013	All	All

If the radio is switching to the Bluetooth audio selection whenever a paired phone makes any sound, such as typing or an incoming email or text message, check the BT-Audio Autoplay setting in the Media Setup menu as shown below. If BT-Audio Autoplay is on (checked), switch selection off and retest for concern. If radio software is 0016 or 0007, radio may require software update as per TB 91-13-05 (2031136) to allow BT-Audio Autoplay to switch off.

55-13-01 TT - Rear Lid Does Not Open After Handle Replacement

Model(s)	Year	Eng. Code	Trans. Code	
Jetta Wagon	2001–2006	All	All	
Touareg (without Rear View Camera)	2004–2008	All	All	
If the rear lid handle is replaced with part number 1J0 827 566L, the microswitch from the original handle must be transferred to the new handle. If original microswitch is not available, microswitch part number 1J5 962 104 B should be ordered and installed.				

Model(s)	Year	Eng. Code	Trans. Code
Tiguan	2009–2013	All	All

Specified fuel pump pressure value from the in-tank (low side) fuel pump is 3.7 bar or higher when tested.

Ensure fuel pressure is checked with a gauge that measures absolute fuel pressure such as the VAS 6550. If fuel pressure is checked with a gauge that measures relative fuel pressure, the gauge may incorrectly indicate pressure is below specified value.

Back to top

Campaigns

No new campaigns this week.

Back to top

Updates

No new updates this week.

Back to top

Suggestions

Please send comments or suggestions to: vwoa.workshopinformation@vw.com

Back to top

© 2013 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by

any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.