



# Service Bulletin

File in Section: 08 - Body and Accessories

Bulletin No.: 09-08-42-005D

Date: August, 2013

## TECHNICAL

**Subject:** Driver/Passenger Door and/or IP Accent Lighting – Light Bar (Pipe) Inoperative or Loses Intensity

**Models:** 2010-2014 Chevrolet Camaro  
Equipped with Light Piped Door Trim (RPO FCR)

**Attention:** The lighting does not carry on to or across the instrument panel.


This bulletin has been revised to add the 2014 model year and update the Labor Operation to the Global Labor Code (GLC). Please discard Corporate Bulletin Number 09-08-42-005C.

### Condition

Some customers may comment that the accent lighting on the door trim panel loses intensity and does not carry on across to the instrument panel.

### Cause

**Note:** The lighting does not carry on to or across the instrument panel.

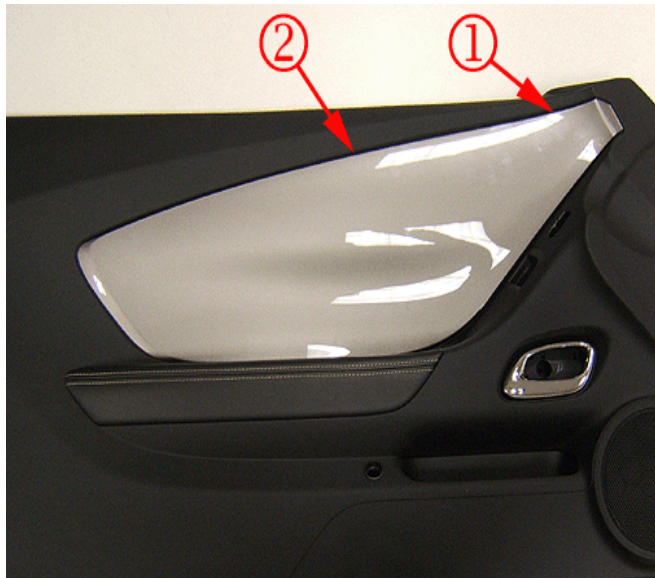


2294397

The normal operation of the door accent lighting is the light will be brightest at the rear of the door panel and gradually lose intensity until approximately 76 mm (3 in) (1) from the front edge of the trim panel. The lighting does not carry on to or across the instrument panel. If the light stops at the center of the door (2), proceed with this bulletin.

### Correction

**Important:** Do not replace the door trim panel to correct illumination concerns.

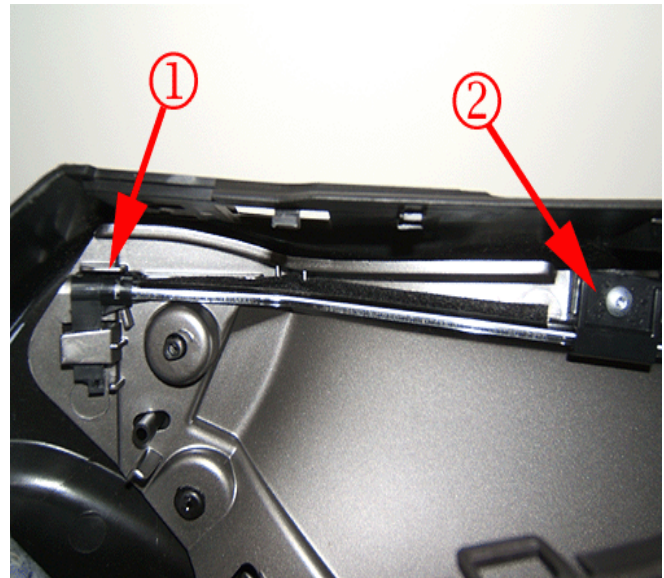

2294398

If the light stops at the center of the door, remove the trim panel and make sure the light bar (pipe):

1. Is in the channel
2. Has not dipped down
3. Is properly retained by the retaining clips (2)
4. End cap (1) is properly installed

To verify normal operation, apply 12 volts to the connector and make sure the light is brightest at the rear of the panel and gradually dims towards the front of the door panel.

If the light bar (pipe) is not illuminated the full length, is noticeably different from side to side or inoperative, replace the lamp-harness assembly. There are two different part numbers based on the illumination color of the lamp.

### Parts Information

Part Number	Description
92228416	Lamp – Front Side Door Map Pkt Illum (Orange)
92238395	Lamp – Front Side Door Map Pkt Illum (Silver)

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2080048*	Door Accent Lighting Check	0.4♦hr
Add	To Check Other Door	0.3♦hr
Add	To Replace One Lamp Assembly	0.1♦hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

