



# Service Bulletin

File in Section: -

Bulletin No.: PIC5615

Date: January, 2012

## PRELIMINARY INFORMATION

**Subject:** IPC Inoperative Code U0155 Set**Models:** 2012 Chevrolet Sonic


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

**Condition/Concern:**

A customer may comment that intermittently the IPC may go inoperative and the only thing working is the check engine light. Upon inspection the technician may find code U0155 set.

**Recommendation/Instructions:**

Before performing diagnostics, technicians are instructed to inspect fuse F26DA in the IP fuse block for a spread terminal and a damaged fuse. Upon inspection if the terminal is found to be spread, technicians are instructed to use a suitable tool to close gap in terminal and replace fuse.

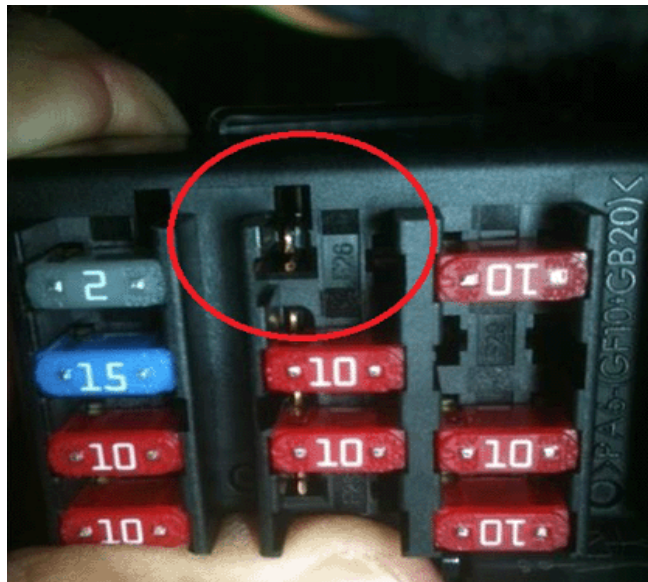

2747005

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.