

**SB-10044440-6414**



<b>Countries:</b>	CANADA, UNITED STATES, PUERTO RICO	<b>Document ID:</b>	IK0800246
<b>Availability:</b>	ISIS, FleetISIS, Body Builder	<b>Revision:</b>	4
<b>Major System:</b>	ELECTRICAL SYSTEM	<b>Created:</b>	9/10/2010
<b>Current Language:</b>	English	<b>Last Modified:</b>	12/6/2013
<b>Other Languages:</b>	<a href="#">Français</a> , <a href="#">Español</a>	<b>Author:</b>	Will (Mark) Wiley
<b>Viewed:</b>	372		

[Less Info](#)

Hide Details

Coding Information

<b>Copy Link</b> 	<b>Copy Relative Link</b> 	<b>Bookmark</b>  <a href="#">View My Bookmarks</a>	<b>Add to Favorites</b> 	<b>Print</b> 	<b>Provide Feedback</b> 	<b>Helpful</b>  14	<b>Not Helpful</b>  1
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	-----------------------------

**Title: Manual Mode Button on the Eaton Shift Console is flashing with No Active Codes in the TCM. With Active Code 3655, 3654 or 3656 in the Body Controller.**

**Applies To: ProStar/LoneStar with Eaton Ultra and Auto Shift Transmissions**

**DESCRIPTION**

On ProStar and LoneStar units the steering wheel switch on the right hand side has a built in up shift and down shift buttons. If you have a 3654, 3655, 3658 or 3656 active in the BC, and no active codes in the TCM, replace the switch and test.

***If you unit was not built with up/down shift buttons, refer to [IK0800465](#)***

**SYMPTOMS**

- Manual mode button on the Eaton shift console flashing. No TCM active codes.

**POSSIBLE DIAGNOSTIC TROUBLE CODES**

DTC	MODULE	DESCRIPTION
3654	Body Controller	The Steering Wheel Manual Switch is Stuck
3655	Body Controller	The Steering Wheel Shift Up Switch is Stuck
3656	Body Controller	The Steering Wheel Shift Down Switch is Stuck
3658	Body Controller	The Steering Wheel Switch Voltage input 0 or Debounced Switch Voltage 0

Hide Details

Feedback Information

Viewed: 371  
Helpful: 14  
Not Helpful: 1

No Feedback Found