



Service Bulletin

File in Section: -

Bulletin No.: PIC5720

Date: September, 2012

PRELIMINARY INFORMATION

Subject: Hum Or Buzz Noise Right Front Service Brake Assist Or ABS MIL

Models: 2012 - 2013 Buick Lacrosse eAssist
 2012 - 2013 Buick Regal eAssist
 2013 Chevrolet Malibu ECO eAssist
 With Hybrid Propulsion (RPO HP6)

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


Condition/Concern:

Condition: A customer or technician may comment that a buzz or hum noise is heard in the right front at times, possible when turning or driving straight down the road. They may also indicate the ABS MIL or Service Brake Assist Message may be displayed. The following DTC's may be set C027B or C0040.

Concern: Forward lamp harness maybe contacting the crank pulley, air conditioning compressor pulley or accessory drive belt due to misrouting or not secured properly.

Recommendation/Instructions:

Repair wiring as needed or replace the forward lamp harness, correct routing and properly secure. Once wiring repairs are complete confirm proper brake booster vacuum pump operation. The pump can be commanded on using GDS2.

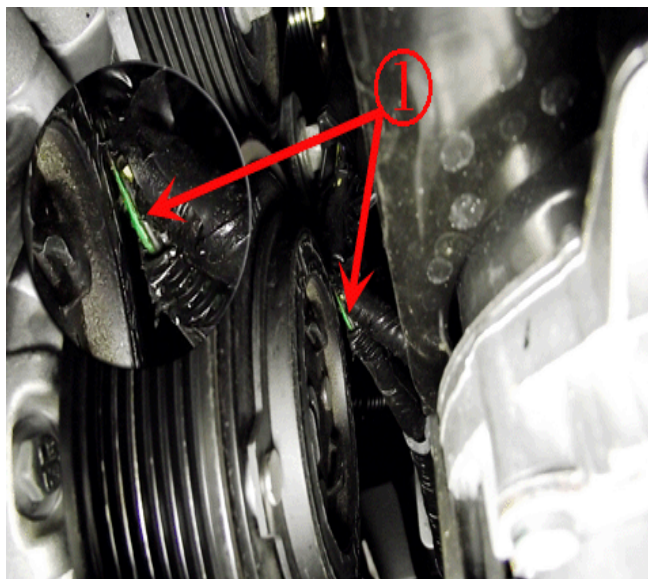

2905462

Warranty Information:

For vehicles repaired under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information. Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.