



Ferrari North America

Technical Information

Date:	February 5, 2013
Bulletin #:	2065
Campaign #:	
Supersedes:	
Section:	9

Model Type: FF (F151)
Model Year: All Applicable
Subject: Improving accessibility to battery conditioner connector

- NOT applicable for version with Rear Seat Entertainment / TV Tuner -

The following procedure may be proposed to the customer to improve accessibility to the battery conditioner connector.

The procedure consists of cutting a hole, if not already present, in the right hand taillight cover panel in the luggage compartment, to improve accessibility to the battery conditioner connector.

Note that this procedure is not covered by the warranty.

The parts to be installed are:

- Battery conditioner identification cap **Part No. 84969300** Q.ty 1


Procedure

- Open the luggage compartment lid.
- Disconnect the battery (as described in paragraph **F2.01** step 3 of the Workshop Manual).
- Remove the right hand taillight cover panel (as described in paragraph **E4.06** step 1 of the Workshop Manual).




Ferrari North America

- Referring to the dimensions in the figure, mark the inner side of the taillight cover panel (1) in the position indicated – Fig. 1.

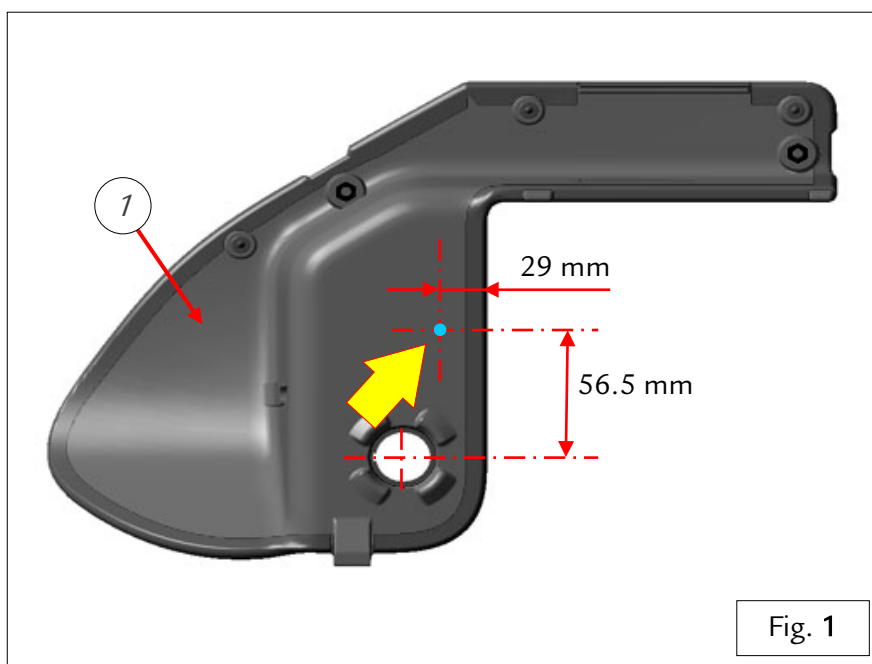

- Using a drill with a **5 mm** bit, cut a through hole in the position marked previously on the inner side of the taillight cover panel (1) – Fig. 2.

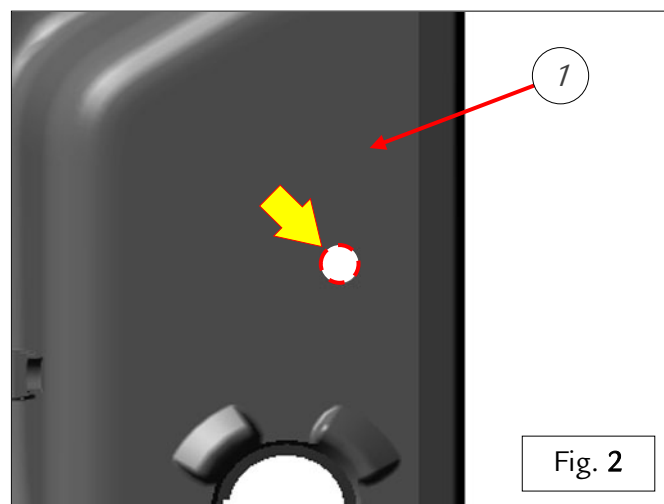




Ferrari North America


- Using a drill with a **34.5 mm** hole saw, cut a hole as indicated **without cutting through the leather trim**, inserting the pilot bit in the hole made previously on the inner side of the taillight cover panel (1) – Fig. 3.

Note: DO NOT cut through the leather trim of the taillight cover panel.

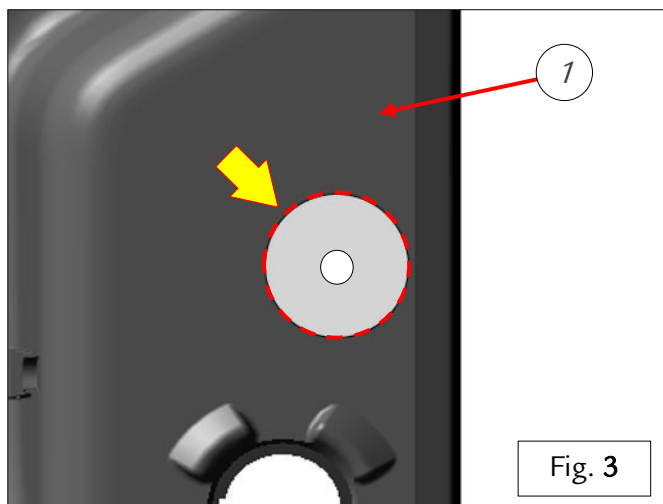

- Using a flat file and referring to the dimensions in the figure, file the two notches indicated in the circumference of the hole cut in the inner side of the taillight cover panel (1) – Fig. 4.


Note: DO NOT cut through the leather trim of the taillight cover panel.

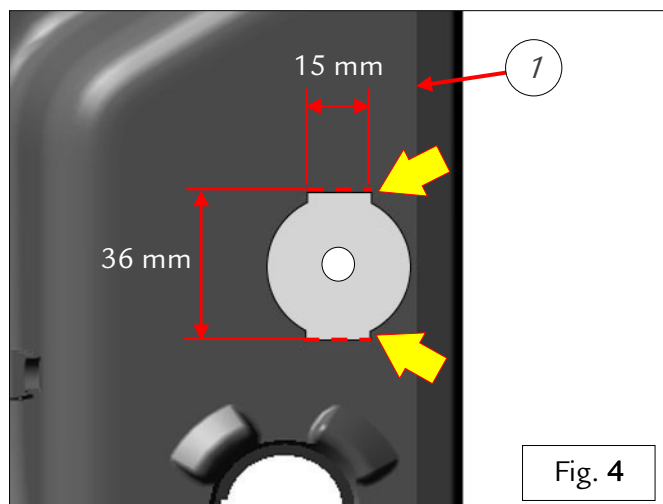




Ferrari North America

- Using suitable scissors, cut out the star shape indicated by the dotted lines in the leather trim of the taillight cover panel (1) – Fig. 5.
- Using a hot glue gun, apply a bead of hot glue where indicated by the dotted circle in the figure on the inner side of the taillight cover panel (1) – Fig. 5.

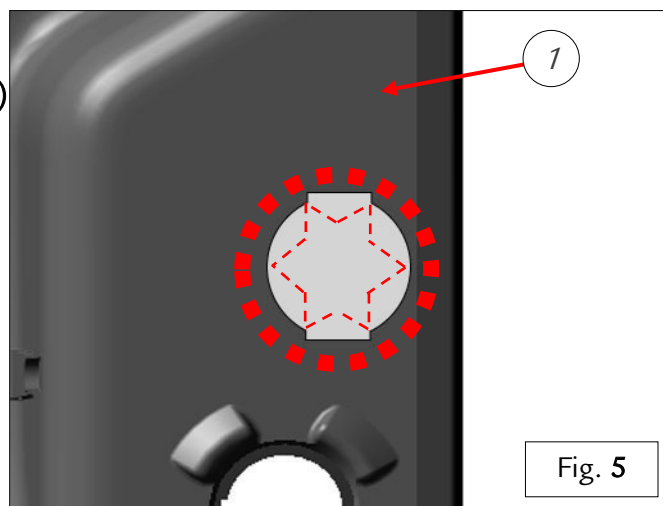


- Fold the indicated flaps of leather through the hole and onto the inner side of the taillight cover panel (1), affixing onto the glue applied previously – Fig. 6.

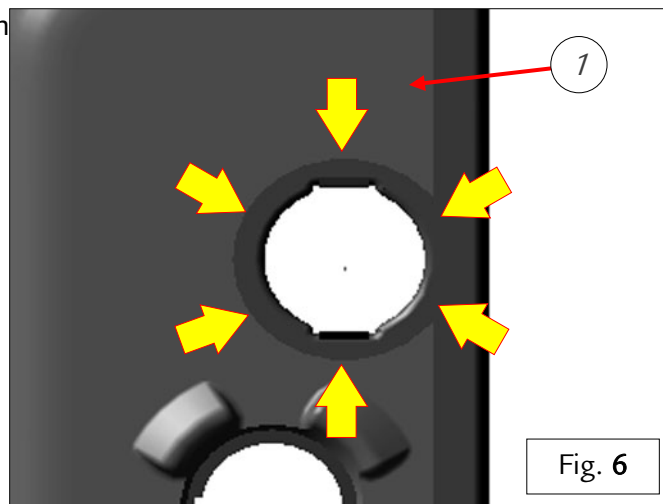



Ferrari North America

- Fit the battery conditioner identification cap **Part No. 84969300 (2)** in the respective hole made previously on the outer side of the taillight cover panel (1) – Fig. 7.

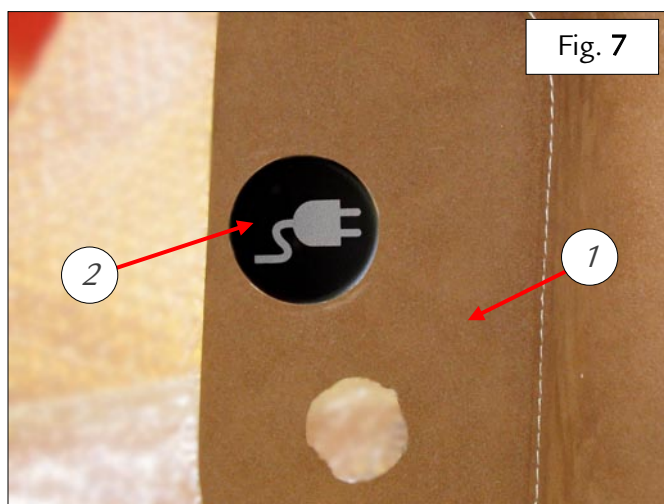

- Refit the right hand taillight cover panel (as described in paragraph **E4.06** step 2 of the Workshop Manual).
- Reconnect the battery (as described in paragraph **F2.01** step 4 of the Workshop Manual).

Note: Follow the procedure for restoring the self-adaptive parameters (as described in paragraph **F2.01** of the Workshop Manual).

Thank you for your co-operation.