## SB-10051648-5392



 Major System:
 EXHAUST
 Created:
 12/20/2012

 Current Language:
 English
 Last Modified:
 1/10/2013

 Other Languages:
 NONE
 Author:
 Charles Sun

Viewed: 850

Less Info

| Hide Details |                    |                   | C                | Coding Information |                  |         |             |
|--------------|--------------------|-------------------|------------------|--------------------|------------------|---------|-------------|
| Copy Link    | Copy Relative Link | Bookmark          | Add to Favorites | Print              | Provide Feedback | Helpful | Not Helpful |
| ලෙ           |                    | View My Bookmarks | *                |                    | 严                | 26      | 6           |


Title: Rear Exhaust Manifold Leak

Applies To: MaxxForce® DT, 9 and 10 (2010 M.Y.)

## **DESCRIPTION**

When truck is serviced for rear exhaust manifold leak, check for presence of a square shaped ear at rear of exhaust manifold. Current production exhaust manifolds have been modified to remove ear and existing inventories had these ears machined off.



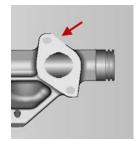


**Current Manifold** 

Revised Manifold



Photo Showing the Revised Manifold

# PARTS

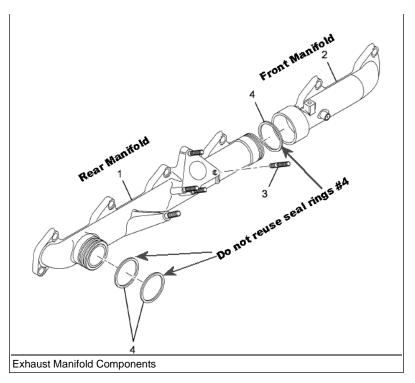

## PARTS:

#### Exhaust Manifold Kit

| Part Number 7092501C91 |            | Description                          | Qty |
|------------------------|------------|--------------------------------------|-----|
|                        |            | Exhaust Manifold Kit                 | 1   |
| Kit Contents           | 1882697C95 | Exhaust Manifold Assembly            | 1   |
|                        | 1886793C1  | Exhaust Manifold Gasket              | 1   |
|                        | 1845040C1  | Stud, Turbo Adapter                  | 5   |
|                        | 1841365C3  | Bolt, Prevailing Torq M12x 1.75x40MM | 1   |
|                        | 7079906C1  | Stud, Prevailing Torq                | 3   |
|                        | 40066R1    | Nut, M8 HF Lock                      | 3   |
|                        | 1873161C2  | Bolt, M12 X 1.75X70MM                | 5   |
|                        | 1891394C1  | Bolt, M12 X 70 Stud                  | 3   |
|                        | 1889332C92 | Kit, Turbocharger Seals              | 1   |

Other Part Options

| Item | Current Part | Description   |
|------|--------------|---|
| 1    | 7092501C91   | Exhaust Manifold Kit                                  |
| 1    | 1883380C4    | Rear Exhaust Manifold                                 |
| 2    | 1882405C2    | Front Exhaust Manifold                                |
| 3    | 1845040C1    | Studs Turbo adapter                                   |
| 4    | 1889134C91   | Seal Rings - Serviced as Kit Qty of 8 - PN 1889134C91 |

#### NOTE

Part illustrations and part numbers are provided as a reference. Always check the Parts Catalog for the specific vehicle or engine.

## SERVICE PROCEDURES

### NOTE:

When replacing or servicing the Exhaust Manifold , The bolts should not be re used . Always replace Exhaust Manifold retaining bolts and studs.

Proper bolt torque and sequence must be followed. Apply a light coat of clean engine oil on bolt threads and under the bolt head when installing.

Exhaust Manifold installation procedures - <u>EGES 450-1 - Page 183 PDF</u>

Exhaust Manifold installations procedures - EGES 450-1 Page 180 - HTML

| Hide Details |   | Feedback Information   |                         |  |
|--------------|---|--|-------------------------|--|
|              |   | Viewed: 849  |                         |  |
|              |   | Helpful: 26  |                         |  |
|              |   | Not Helpful: 6   |                         |  |
| Staff<br>ID  |   |  | Created<br>Date         |  |
|              | DYYNJZ1 You received the following feedback From: dyynjz1 - Nick Zogelman Email Address: nick@williamsservice.com Job Classification: SE003, Service Manager Dealer: WILLIAMS SERVICE Feedback: is this for information only or are we to do somethig about old manifolds |  |                         |  |
| U01C661      |   | You received the following feedback From: U01C661 - Charles Sun Email Address: SMTP:{Charles.Sun@navistar.com}Charles.Sun@navistar.Charles.Sun@navistar.com}Charles.Sun@navistar.com}Charles.Sun@nav | 1/15/2013<br>3:27:49 PM |  |

Copyright © 2013 Navistar, Inc.