# **Technical Journal**



# Headlamp, vibration



REF NO: TJ 27277				CAR MARKET: United States and Canada		
3 US 7510 V	PARTNER: olvo Cars North America	ISSUE DATE: YEAR MONTH DAY				
FUNC GROUP:	FUNC DESC:	2013	02 26			
3521	Headlamp, vibration		Page 1 of 7	2 26		

"Fixed Right — First Time"

#### **Attachment**

File Name	File Size
TJ 27277.pdf	0.5403 MB

# **Vehicle Type**

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
156							2010-2013		0000212-9999999	200835-201248

## **CSC** Customer Symptom Codes

Code	Description
LC	Headlights/Bulbs blow frequently
H1	Body frame/Squeak/rattle/Front outer body
3Q	Headlights/Vibration/shake

## DTC Diagnostic Trouble Codes

#### **Text**

CSC = Customer Symptom Code DTC = Diagnostic Trouble Code

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

# **Technical Journal 27277**



#### **DESCRIPTION:**

The headlamp may vibrate due to a broken fixation pin retainer.

#### **SERVICE:**

In case of customer complaints, check the headlamp retainer for damages. Repair the headlamp according to attached instruction.

#### **PRODUCT MODIFICATION:**

Improved headlamps has been implemented in production 2012 week 48.

#### **VSTG OPERATION NUMBER:**

98461-2 Headlight adjustment incl light setting 0.3 hrs

- Claims may be submitted under the new car warranty when there is a documented customer complaint using claim type: 01
- Labor times are valid at the time of release and are subject to change.

To view TJ attachments continue to next page: This TJ has 1 attachment.

Page 2 of 7 2013-02-26

	Volvo Car Customer Serv			
VOLVO		TJ Instruction		
		TJ No 27277		
		Date		
		February 2013 Issue 01		
Title	Headlamp vibration			

Materials	Quantity	Part No.
Chemical gasket	0.01	31316814
Bracket*	1.0	31395688
Emery cloth	1.0	Shop supplies

<sup>\*</sup> One bracket needed for each retainer broken.

1.

**Note!** Some variation in the illustrations may occur, but the essential information is always correct



Page 2 (5)

#### Removal

Note! Removal steps in this procedure may contain installation details.

Remove the headlamp, refer to:


Removal, replacement and installation


3 - Electrical system

35 - Lighting

352 - lighting, front


## Repair

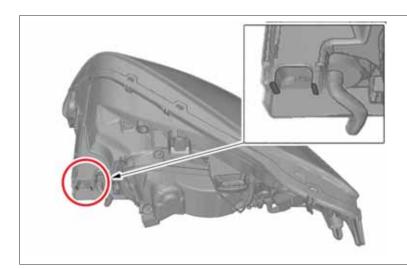

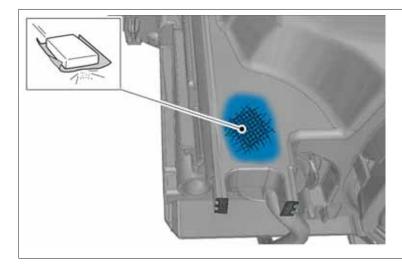


Use: Emery paper


Page 3 (5)

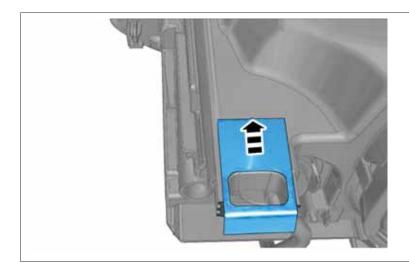


Caution! Make sure that the component is positioned correctly.

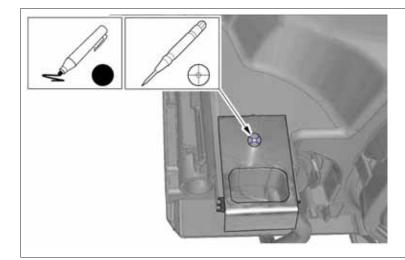


Use an automatic Center Punch.Scribe/mark up

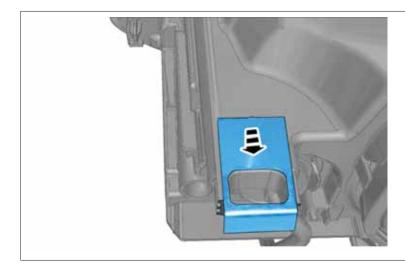


Page 4 (5)

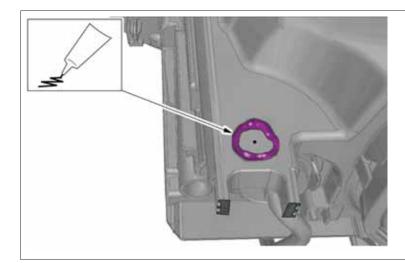

Use: Chemical gasket, 31316814

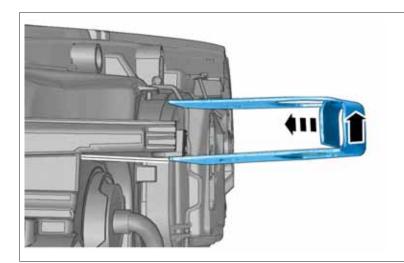

Caution! Make sure that the component is positioned correctly.

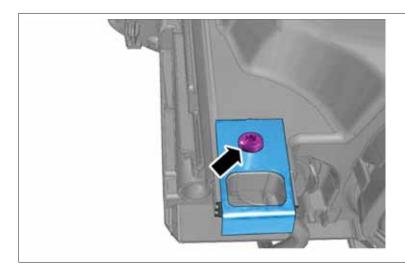

Note! Only use moderate force. Install the screw.

# SB-10051800

	Page 5 (5)
Installation	
	To install, reverse the removal procedure.