

SB-10051884-1956

Countries: AUSTRALIA, BRAZIL, CANADA, UNITED STATES, SOUTH AFRICA
Availability: ISIS, FleetISIS, Body Builder
Major System: ENGINES
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 1883

Document ID: IK1200416
Revision: 3
Created: 10/27/2009
Last Modified: 3/14/2013
Author:

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 298	Not Helpful 584
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	---------------------------	-------------------------------

Title: Dual Throttle Pedal Harness Troubleshooting

Applies To: 7000 4000 Models with Dual Throttle Harness and Switch Installed.

DESCRIPTION

Dual throttle pedals are inoperative.

SYMPTOMS

- Will not accelerate
- Check engine light on

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
134	Engine	APS/IVS conflict


TROUBLESHOOTING

1. Remove dash panel and inspect wiring on switch.
2. Refer to [TSI 10-08-01](#). With a dual pedal set up, the **NEW STYLE SENSOR** listed in the **TSI WILL NOT WORK**.

SERVICE PROCEDURE

1. Check the wires on the back of the selector switch
2. Verify that wire 99B is in cavity B
3. Verify that wire 99D is in cavity E
4. If these are incorrect please swap the two wires.
5. If these wires are in the correct locations please follow the correct Iknow article for the aps troubleshooting.

CIRCUIT DIAGRAM

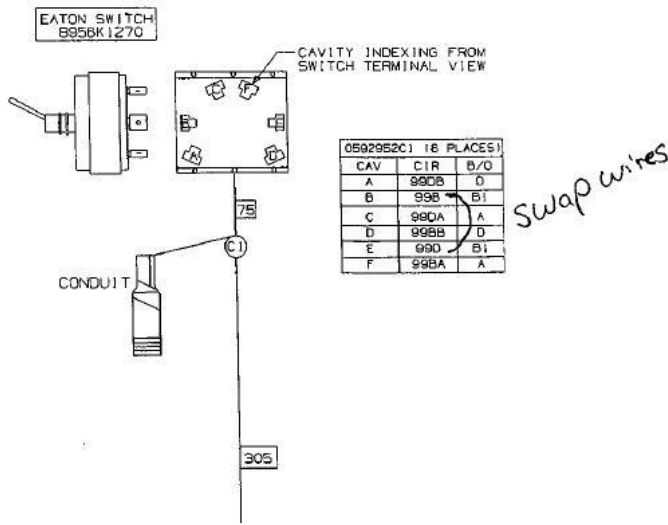

Hide Details

Feedback Information

Viewed: 1882
 Helpful: 298
 Not Helpful: 584

No Feedback Found