Knocking/creaking noises from area of front axle when maneuvering

8

Topic number LI33.15-P-047471

Version

Design group 33.15 Axle links

Date 12-04-2013

Validity Model series 203 except 4MATIC, model series 171, 209,

204, 207

Reason for change WIS references changed

Reason for block

Complaint:

Knocking/creaking noises from the area of the front axle when maneuvering with steering almost at full lock.

Cause:

Hydro-mount in strut rod.

When maneuvering, the inner stop plug in the hydro-mount collides with the outer sleeve and causes corresponding noises.

Note:

The noise can be best reproduced by driving a figure - 8 in reverse. If the noises occur during this maneuver, then the steering gear is definitely not the cause and must not be replaced.

Remedy:

Replace hydro-mounts on both strut rods. See EPC for part number.

Important: If no rubber boots are present, they must be retrofitted. Follow assembly instructions in WIS.

Symptoms Chassis/suspension / Chassis, noises / Knocking Chassis/suspension / Steering system / Steering noise / Chattering/knocking Chassis/suspension / Axle / Front axle / Front axle, noise / Knocking Chassis/suspension / Axle / Front axle / Front axle, noise / Grunting

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A2113330697			Boot	4	Follow assembly instructions in WIS.	Х	

XENTRY

WIS-References			
Document number	Title	Note	Allocation
AR33.15-P-0160P	Remove/install torque strut at front axle	Model 203 except 4MATIC, 209	Remedy
AR33.15-P-0160-02P	Press in/out rubber mount of strut rod	Model 203 except 4MATIC, 209	Remedy
AR33.15-P-0160V	Remove/install torque strut at front axle	Model 171	Remedy
AR33.15-P-0160-02V	Press in/out rubber mount of strut rod	Model 171	Remedy
AR33.15-P-0159EW	Install/remove rubber mount of strut rod	Model 204 except 4MATIC, 207 except 4MATIC (Strut rod remains bolted in steering knuckle at ball joint end)	Remedy
AR33.15-P-0160-02EWS	Press in/out rubber mount of strut rod	Model 204 except 4MATIC, 207 except 4MATIC (Strut rod remains bolted in steering knuckle at ball joint end)	Remedy
AR33.15-P-0160CW	Remove/install torque strut at front axle	Model 204 4MATIC, 207 4MATIC	Remedy
AR33.15-P-0160-02SXY	Press in/out rubber mount of strut rod	Model 204 4MATIC, 207 4MATIC	Remedy
AR33.15-P-0160-03T	Remove/install rubber boots at rubber mount	Model 171, 172, 203, 204, 207, 209, 211, 212, 216, 218, 219, 221, 230 (Rubber boots must always be retrofitted!)	Remedy

/alidity						
Vehicle	Engine	Transmission				
C (203)	*	*				
C (204)	*	*				
CLK (209)	*	*				
E (207)	*	*				
GLK (204)	*	*				
SLK (171)	*	*				