

SB-10052014-1599



SI B65 11 13
Audio, Navigation, Monitors, Alarms, SRS

March 2013
Technical Service

SUBJECT

CIS Seat Mat Replacement

MODEL

F01

F02

F04

F07

F10

F12

F13

SITUATION

Installation of a new CIS (capacitive sensing passenger occupancy mat) will not enable with ISTA/P.

CAUSE

Wrong coding in the spare part from the supplier

CORRECTION

This is an update to a topic presented in the February 2013 SRT (Service Roundtable).

Feedback from the field has indicated that some parts that do not have the label (as mentioned in the SRT) are correctly enabled using ISTA/P.

Install the replacement CIS mat in the vehicle (whether it has a label or not) and code the ACSM (Advanced Crash Safety Module) with ISTA/P.

If the following ACSM faults are still present, the CIS mat is not enabled. Submit a TTS PuMA case for Parts Group assistance.

- FC 9309ED - ODS-system: seat occupancy sensor Passenger: not yet enabled
- FC 9309F4 - ODS-system: seat occupancy sensor Passenger: could not be enabled

WARRANTY INFORMATION

Not applicable.

[Copyright ©2013 BMW of North America, Inc.]