



TECHNICAL SERVICE BULLETIN

TSB#: 13-002 Job Code: 99801153 Flat Rate: 0.25 HRS

NOTE: This Technical Service Bulletin will be valid within (1) year from the original date of publication. REQUIRES PARTS TO BE ORDERED FROM Jayco for every unit.

ACTION REQUIRED: Replace the struts on both sides of the Murphy bed

MODELS / UNITS:

2013 Jay Feather Ultra Lite Travel Trailers

23M **D1JW**0050 - 0091, 0093 - 0114, 0116 - 0119, 0121 - 0124, 0126 - 0127, 0129 - 0131, 0134, 0137 - 0140

20M **D1JX**0050 - 0055, 0057 - 0060, 0062 - 0063, 0066, 0069 - 0070, 0075 - 0080

KIT CONTENTS

- 13-002
- (2) Struts
- (1) Caution label
- Instruction sheet


Note: Kit can only be ordered using the order form included with this bulletin.

TOOLS/MATERIAL REQ.:

Flat screwdriver or similar tool

INSTRUCTIONS

1. Open the sofa into the bed position. Open the Murphy bed.
2. Using a clean rag and soapy water, clean a small area in the center of the rear wall. Allow the area to thoroughly dry.
3. Apply the caution label to the back wall.
4. Move the mattress to the side away from the strut.
5. Using the flat head screwdriver, carefully pry the strut out of the top bracket. Remove the strut from the bottom bracket.
NOTE: It is not necessary to remove any of the strut brackets.
6. Insert the replacement strut in the bottom bracket. Apply enough pressure to the strut so it clears the top bracket. Insert the top of the strut in the top bracket.
7. Repeat Steps 4-6 on the other side.

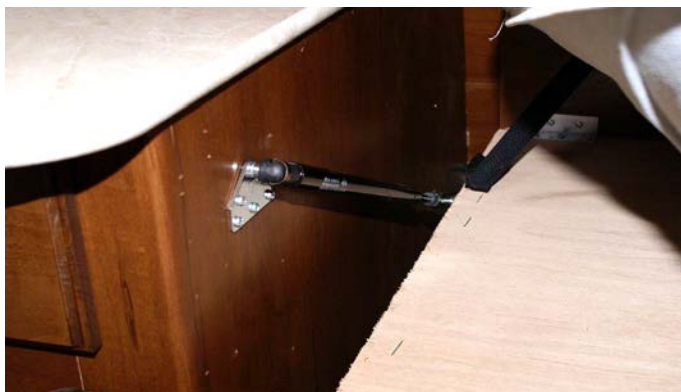

DISCARD REMOVED STRUTS

THESE STRUTS SHOULD NOT BE RE-USED ON ANY JAYCO MURPHY BED APPLICATION(S)