

SB-10052508-4836



Countries: CANADA, UNITED STATES, PUERTO RICO
Availability: ISIS
Major System: EXHAUST
Current Language: English
Other Languages: NONE
Viewed: 369

Document ID: IK0700057
Revision: 1
Created: 4/3/2013
Last Modified: 12/13/2013
Author: Steve Kueller

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 11	Not Helpful 0
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	-----------------------------

Title: Terra Exhaust Leak Repair at Turbocharger Adapter to Down Pipe Joint

Applies To: TerraStar Models

DESCRIPTION

TerraStar Exhaust Leak between the Turbocharger Adapter and the Turbocharger Down Pipe

PARTS INFORMATION

Part #	Description	Qty.
1891515C1	Gasket	1

REPAIR PROCEDURE

Remove the V-Band Clamp that retains the Turbo Down Pipe to the Adapter.
 Install gasket listed between the mating flanges and reassemble.
 Inspect V-Band clamp P/N 3844630C1 for damage and replace if required.
 Install clamp and Torque Clamp to Specs 14-18Nm / 124-168 lbs. inch


Leak at Down Pipe Flange Area



Joint & Clamp Location at Rear of Engine



Install Gasket between two Flanges

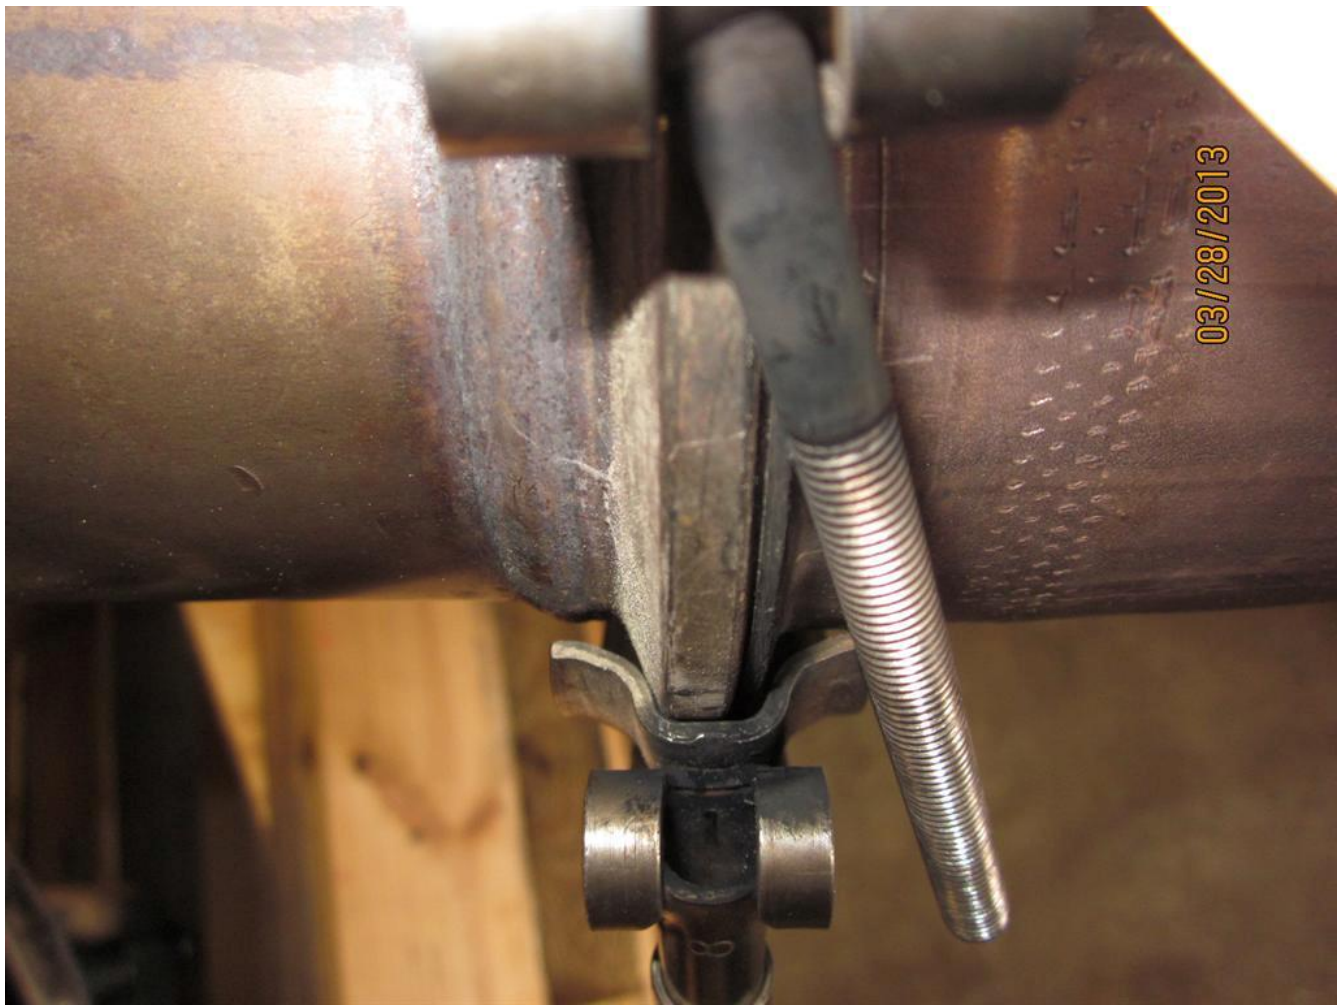

[Hide Details](#)

Feedback Information

Viewed: 368
Helpful: 11
Not Helpful: 0

No Feedback Found

Copyright © 2014 Navistar, Inc.