SB-10052597-7571

Reference SSM52757

Range Rover Sport / L320

Models LR3 / L319

LR4 / L319

Title Brake Switch Adjustment and Setting Procedure

Category Chassis

Last modified 23-May-2013 00:00:00

Symptom 301000 Service Brake System

Issue:

Excessive brake pedal pressure required to get the auto transmission out of park, warning lights on the instrument pack with associated DTC's for brake light switch (P0504-27, P0504-62, C1A96-64) or brakes showing signs of drag and binding.

Cause:

Content

Incorrect brake light switch setting.

NOTE: Analysis of returned brake switches have shown no issues with the brake switch itself. Do not replace the switch before adjustment is carried out.

Action:

Refer to TOPIx section 303-14 - General Procedures. Brake pedal position switch adjustment, to ensure that the brake light switch is correctly set prior to any other rectification being carried out.