


EGR Temperature Sensor Routing
VAH, VHD, VN
D13H

FSB 293-022, EGR Temperature Sensor Routing

(August 2013)

Information

In the event that an EGR temperature sensor replacement is required on a VOLVO D13H engine, a new routing configuration is required. The new configuration requires three double loop cable ties (part number 8079360) to secure the new EGR temperature sensor connector directly to the coolant pipe. On previous installations, the venturi pipe was a mounting point and only two ties were required.

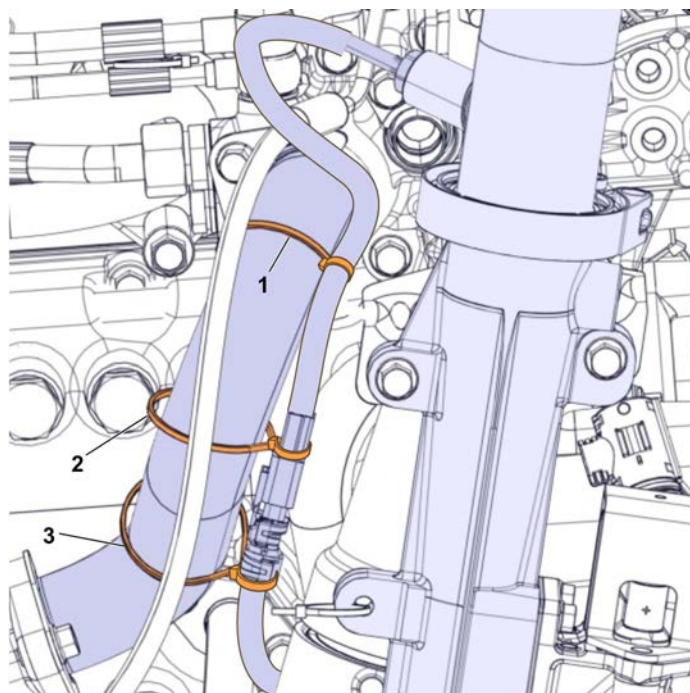

W2083701

- 1 Tie attaches 76 mm (3 in) above the back shell on the temperature sensor harness.
- 2 Tie attaches between the back shell and the temperature sensor connector.
- 3 Tie attaches directly below the back shell on the engine harness side.

Service personnel: Please circulate, read and initial

Service Manager	Warranty Administrator	Workshop Foreman	Service Technicians						