

SUN VISOR VANITY MIRROR DOOR WILL NOT CLOSE OR IS LOOSE—BUILT ON OR BEFORE 8/31/2012

TSB 13-5-30

FORD:
2012-2013 Mustang

2012 Escape
2012-2013 Explorer, F-150

ISSUE

Some 2012 Escape, 2012-2013 F-150, Explorer and Mustang vehicles built on or before 8/31/2012 may exhibit a sun visor vanity mirror door that will not close or is loose. This may cause the mirror light to stay on.

ACTION

Follow the Service Procedure Steps to correct the condition.

SERVICE PROCEDURE

- Using a small flat head screw driver, remove plastic light cover by pushing out to the right. (Figure 1)

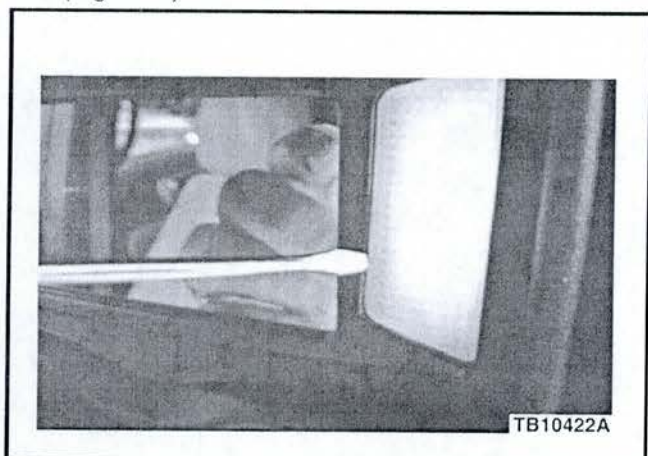


Figure 1 - Article 13-5-30

- Remove the two (2) phillips screws attaching vanity mirror to the sun visor.
- Using flat head screw driver, pop up right side of vanity, slide to the right to remove vanity.

- Carefully remove switch assembly and light socket and bulb from retaining clip and pegs. (Figure 2)

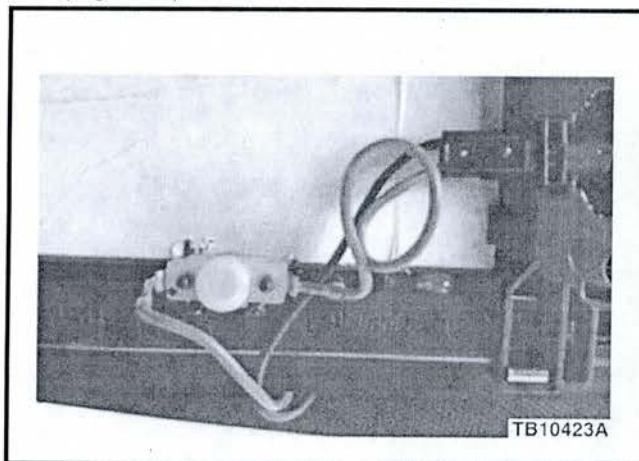


Figure 2 - Article 13-5-30

- Line up switch assembly and light socket with retaining clip and pegs in the new vanity mirror and snap into place.
- Insert vanity slightly on an angle left to right back into visor, ensuring pegs on visor engage holes in vanity assembly.
- Attach vanity to visor with the two (2) screws and reinsert plastic light cover.

PART NUMBER	PART NAME
CL3Z-1504098-AA	Vanity Mirror (Adobe)
CL3Z-1504098-AB	Vanity Mirror (Light Stone)
CL3Z-1504098-AC	Vanity Mirror (Charcoal Black)
CL3Z-1504098-AD	Vanity Mirror (Gray)
CL3Z-1504098-AE	Vanity Mirror (Cashmere)

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

TSB 13-5-30 (Continued)

WARRANTY STATUS: Eligible Under Provisions Of
New Vehicle Limited
Warranty Coverage
Warranty/ESP coverage
limits/policies/prior approvals
are not altered by a TSB.
Warranty/ESP coverage
limits are determined by the
identified causal part and
verified using the OASIS
part coverage tool.

130530B Replace Both (2) Vanity 0.3 Hr.
Mirrors Following Service
Procedure (Do Not Use
With Any Other Labor
Operations)

DEALER CODING

BASIC PART NO.
7004104

CONDITION
CODE
33

OPERATION	DESCRIPTION	TIME
130530A	Replace One (1) Vanity Mirror Following Service Procedure (Do Not Use With Any Other Labor Operations)	0.2 Hr.