

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR JUNE 2013**

32271 2013 Edge/Flex/Taurus/Explorer/MKS/MKT - 6F50/6F55 Transmission - Built before 4/15/13 - MIL With DTCs P0741 And P1744 With No Additional Symptoms

Some 2013 Edge, Flex, Taurus, Explorer, MKS, and MKT vehicles equipped with a 6F50 or 6F55 automatic transmission built before 4/15/13 may exhibit a Malfunction indication Lamp (MIL) illuminated with Diagnostic Trouble Codes (DTCs) P0741 and P1744 with no other symptoms present. This concern may be caused by a torn inner torque converter seal. Replace the torque converter. Refer Workshop Manual, Section 307-01 and applicable service labor times for further details.