ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JUNE 2013

32276 2010-2012 - Taurus, MKS, MKT And Flex - 3.5L GTDI Long Block Replacement

The 3.5L GTDI replacement long block (6006) engines are shipped with the 2013-2014 cam sensors (6A257), crank sensor (6C315), crank sensor tone wheel (12A227) and coolant inlet tube (8A505). If you are installing a replacement long block engine in a 2010-2012 Taurus, MKS, MKT or Flex vehicle equipped with a 3.5L GTDI engine the components listed above must be swapped over from the engine being replaced to the replacement engine before the engine is installed. Failing to swap the cam sensors, crank sensor, crank shaft tone wheel and coolant inlet tube before the engine is installed will require the engine to be removed again to complete the repair.