

© 2013 Mazda Motor of America, Inc.

Subject: DRIVER SIDE SEATBACK RECLINING POSITION CHANGES BY ITSELF WHEN CUSTOMER EXITS THE VEHICLE	Bulletin No: 09-020/13
	Last Issued: 07/11/2013


APPLICABLE MODEL(S)/VINS

2013-2014 CX-5 with VINs lower than JM3 KE***** 338025 (produced April 1, 2013)

DESCRIPTION

Some customers may complain that the driver side seatback reclining position seems to change by itself. This may be caused unknowingly by the customer when they exit the vehicle. The customer's leg may be contacting the recliner switch and changing the seatback reclining position.

NOTE: This issue does not involve any movement of the seatback while the vehicle is being driven.

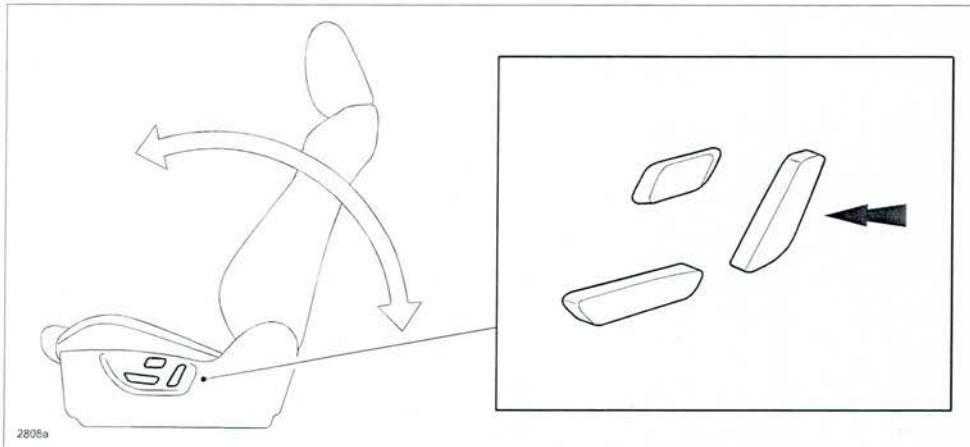

The configuration of the recliner switch has been changed to eliminate this concern.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the recliner switch with a modified new part according to the instructions on MS3 online or the Workshop Manual (section 09-13 FRONT SEAT SIDE COVER REMOVAL/INSTALLATION).
3. Verify the repair.

Bulletin No: 09-020/13
© 2013 Mazda Motor of America, Inc.

Last Issued: 07/11/2013

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
KD35-88-1H5 -02	Recliner Switch (LH)	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	89
Damage Code	9H
Part Number Main Cause	KD35-88-1H5 -02
Quantity	1
Operation Number / Labor Hours:	XXJ8FXRX / 0.2 Hrs.