

Parktronic system and/or Blind Spot Assist nonfunctional

Topic number	LI54.65-P-057140
Version	1
Design group	54.65 Parking assist
Date	08-21-2013
Validity	W166 up to A038117
Reason for change	
Reason for block	

Complaint:

Fault message in instrument cluster: "Park Assist nonfunctional" and/or "Blind Spot Assist nonfunctional"

Cause:

Cable set in left rear bumper damaged in shield/rear muffler area.

Remedy:

Replace damaged cable set and fix in place using cable ties, see pictures.

Attachments	
File	Designation
Bild 1.jpg	Shown without CODE 234 or 237 Positioning of cable ties with edge clip at intervals of approx. 25 cm
Bild 2.jpg	Shown with CODE 234 or 237 Positioning of cable ties with edge clip at intervals of approx. 25 cm

Symptoms
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Acoustic warning malfunction / General
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Function / Automatic shutoff
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Malfunction of displays / General
Communication/information / Warning and control system / Blind spot assist / Nonfunctional

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 001 995 19 90			Cable tie with edge clip	2		X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			88137 36	

Validity		
Vehicle	Engine	Transmission
M (166)	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
166.003	651.960	722.908
166.004	651.960	722.908
166.023	642.826	722.903
166.023	642.826	725.031
166.024	642.826	722.903
166.024	642.826	725.031
166.055	276.955	722.906
166.056	276.821	722.904
166.056	276.925	722.904
166.057	276.955	722.906
166.058	276.955	722.906
166.062	276.821	722.904
166.073	278.928	722.909
166.073	278.928	725.031
166.073	278.928	725.032
166.074	157.982	722.905
166.074	157.982	722.931