

SB-10053893-8645

Reference	SSM66877
Models	LR2 / L359 Range Rover Evoque / L538
Title	L538/L359 EPB Park Brake Activation disabled
Category	Chassis
Last modified	11-Jul-2013 00:00:00
Symptom	302000 Parking Brake System
Content	<p>Issue: Dealers have been reporting instances at PDI where the Electronic Park Brake function is impaired and an associated warning lamp illuminated. The associated DTC is U1A4C-68.</p> <p>Cause: The ignition-off, auto apply feature may be disabled on receipt of vehicle following manufacturing process variations.</p> <p>Action: In instances where the above condition is observed, dealers are requested to carry out the 'Park Brake Activation' routine from the 'Recommendations' tab from SDD to re-enable the functionality. It is imperative that SDD DVD patch 134.06 or later is applied to resolve. Should any vehicles outside the associated VIN range appear with this issue, or should dealers observe any vehicles within the range which cannot be repaired using this process, please report via EPQR where applicable.</p>