

[Traduire](#)



Roadster SE5 Engine Noise - Left Hand Side - Possible Cause

Printable Version

Rate This Article	(Average Rating: No Rating)	Version 1	Language English	Show Properties
-------------------	-----------------------------	-----------	------------------	-----------------

Summary:

On some SE5 engines a high pitched or whining noise may be heard under specific RPM only (only at 3500rpm for example).

Type:

General

TST Detail:


After investigation the cause of this noise is from a thrust washer vibrating and spinning in the HCM.

Inspect the HCM housing for wear; it may need to be replaced.

If the HCM housing doesn't present any signs of wear, replace:

- Thrust washer 420227391
- Needle bearing 420632640
- Oil pump gear, 24 tooth 420434601
- and other associated parts.....gaskets..... as needed.

HCM housing 420611493

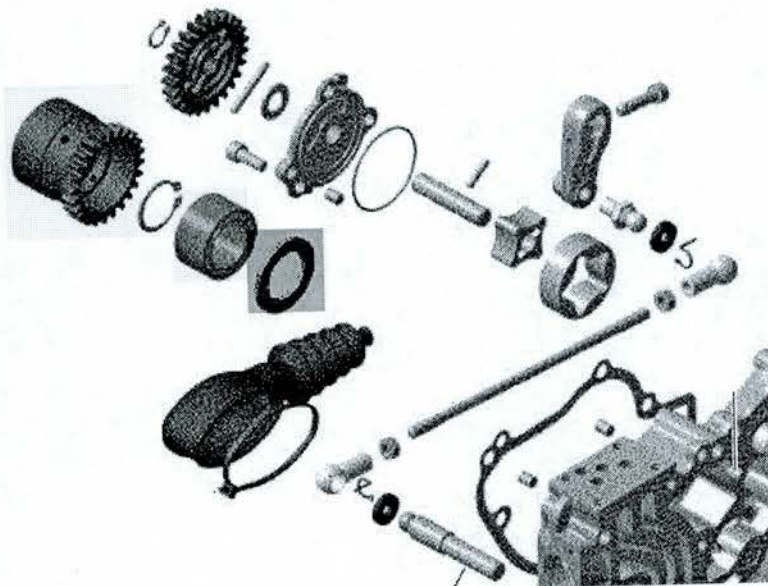

Attachment:

First Published By: Dany Davey on 2013-10-25
Last Modified By: Dany Davey on 2013-10-25