



SERVICE BULLETIN

Classification:

EL13-027

Reference:

NTB13-104

Date:

December 5, 2013

2013 ALTIMA SEDAN AND PATHFINDER; REMOTES DO NOT WORK 20 MINUTES AFTER LOCKING THE DOORS

APPLIED VEHICLES: 2013 Altima Sedan (L33)
2013 Pathfinder (R52)

IF YOU CONFIRM:

All functions of an Applied Vehicle's remotes will not work after the doors have been locked and the BCM goes into "sleep mode" (about 15-20 minutes).

ALL of the following **MUST** be verified in the given order:

1. All remote functions do not work after the BCM goes into "sleep mode".
2. All remote functions will work again after pressing one of the request switches on the vehicle.
3. The issue (all remote functions do not work) repeats after the BCM goes back into "sleep mode" again.
4. Remote signal strength checks OK with Signal Tech II.

ACTION:

1. ALL of the four steps above **MUST** be verified in the given order for this bulletin to apply.
2. If the issue has been verified as stated above, replace the BCM.
 - For BCM replacement procedure, refer to the **M ELECTRICAL & POWER CONTROL > BCS Body Control System** section of the appropriate Electronic Service Manual (ESM).

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

MODEL	DESCRIPTION	PART NUMBER	QUANTITY
2013 Altima Sedan	CONTROLLER ASSY - BCM	284B2-3TA0D	1
2013 Pathfinder	CONTROLLER ASSY - BCM	284B1-3JA1E	1

CLAIMS INFORMATION


Submit a Primary Part (PP) type line claim using the following claims coding:

MODEL	DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Altima	BCM- Replace	(1)	RX3UAA	ZE	32	1.1
	BCM- Configuration		RX3U1A			0.2

(1) Refer to the electronic parts catalog (FAST) and use the (284B2-XXXXX) as the primary failed part (PFP).


MODEL	DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Pathfinder	BCM-Replace	(1)	RX3UAA	ZE	32	1.0
	BCM- Configuration		RX3U1A			0.2

(1) Refer to the electronic parts catalog (FAST) and use the (284B1-XXXXX) as the primary failed part (PFP).

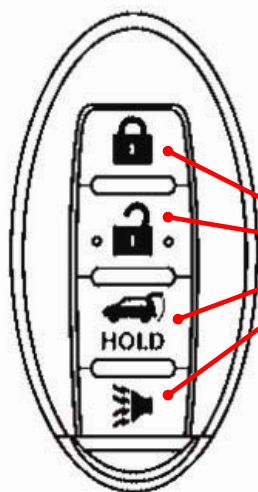

TP130501

Remote
functions
of two
sample
IKeys

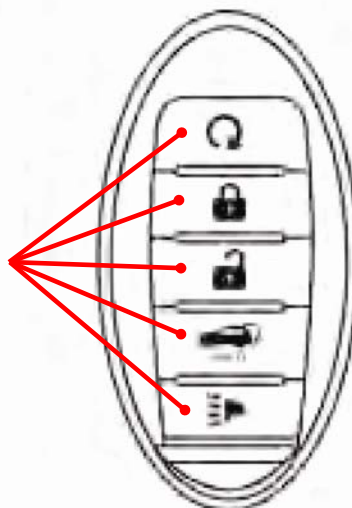

TP130502