VOLVO CARS SERVICE AND PARTS BUSINESS



Technical Journal

TITLE:

Parking assist camera, PAC, flickering video signal in display

REF NO: TJ 27989	ISSUING DEPARTMENT: Technical Service		CAR MARKET: States and C	
3 US 7510 V	YEAR	ISSUE DATE:	DAY	
3 US 7510 Volvo Cars North America FUNC GROUP: FUNC DESC:		2013	12	19
3871	parking assistance		Page 1 of 20	

"Right first time in Time"

Attachment

File Name	File Size
TJ 27989.WMV	0.6697 MB
TJI-27989-1_XC60.pdf	2.2254 MB
TJI-27989-2_S60.pdf	1.1469 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
134							2011-2014		0000001-0299587	201020-201345
156							2010-2014		0084237-0559322	200946-201345

CSC Customer Symptom Codes

Code	Description
2X	Park assist camera/Does not work

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

* Added Attachments and labor op code

Technical Journal 27989



DESCRIPTION:

It may happen that the video signal in the media display is flickering while using the parking assist camera (PAC).

The problem may be related to the cable harness to the PAC unit and possible interference from other wires in the same cable harness. Installing a new cable harness besides the factory fitted cable harness will eliminate the symptom.

PRODUCT MODIFICATION:

New improved cable harness, P/N 31414655 is now available as spare part.

MATERIAL RETURN:

Not Required

VEHICLE REPORT:

Only if there is a repeat repair.

Use concern area "Vehicle Report" and sub concern area "Support not Needed".

SERVICE:

* Install the accessory cable harness PN 31414655 to the PAC unit according to the attached TJ Instructions

VOLVO STANDARD TIMES GUIDE (VSTG) INFO:

Operation number 98508-2 - Wiring park assist camera (PAC) rear replace acc. to TJ27989

- S60 2.2hrs
- XC60 2.7hrs
- Labor times are valid at the time of release and are subject to change.

To view TJ attachment continue to next page. This TJ has 3 attachments. One of the attachments is a video file posted separately.

Page 2 of 20 2013-12-19

Volvo Car Customer Service TJ Instruction 27989-1

Title	Cable harness parking aid camera rear.	Page	1 (11)
Action	Replacement	Operation number:	98508-2

Issue	Date	Reason
1	2013-10	First issue

Affected vehicles

Model year	Model
2010, 2011,	XC60
2012, 2013,	
2014	

Materials


Materials	Qty.	Part No.	Notes
Butyl tape	1	1161783	
Sems screw	4.0	987486	
Cable tie	10	983750	
Harness	1.0	31414655	
Cable tie	3.0	982635	

Special tools


Description	Part No.
Tension spring	951 2932

TJ Instruction 27989-1 Page 2 (11)

Orientation view

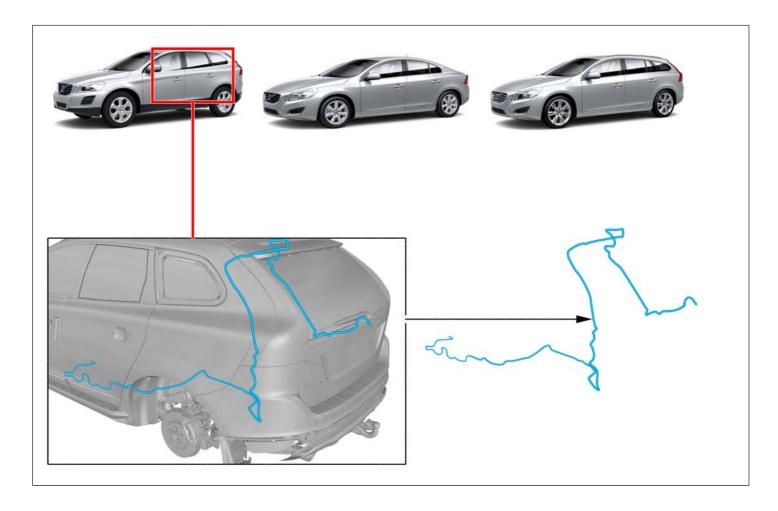

Color symbols

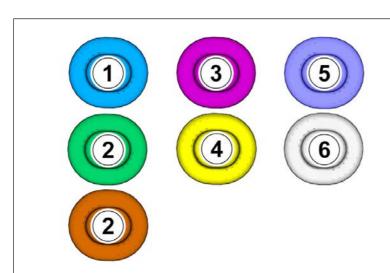

Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- 1 . Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5 . Used for focused component, the component with which you will do something.
- 6 . Used as background color for vehicle components.

TJ Instruction 27989-1 Page 3 (11)

Removal

Detach left front seat, refer to:


Removal, replacement and installation

8 - Body and interior

85 - Interior

852 - front seat, drivers seat, seat bench

type

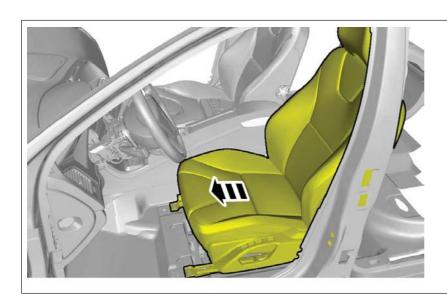

Detach left panel b-pillar, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

851 - upholstery for wall/door, side, rear

shelf, luggage rack

Remove the left-hand side panel in the cargo compartment, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

855 - other upholstery

Remove the seat cushion, rear seat, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

853 - rear seat, passenger seat, bench

TJ Instruction 27989-1 Page 4 (11)

Remove the tailgate/trunk lid trim panel, refer


Removal, replacement and installation

8 - Body and interior

85 - Interior


851 - upholstery for wall/door, side, rear

shelf, luggage rack

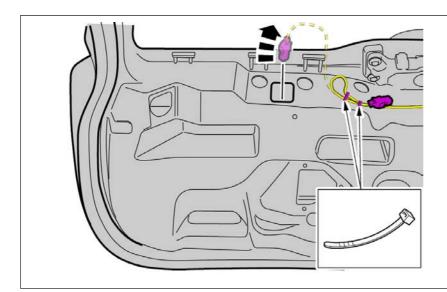


Disconnect the connector.


Installation

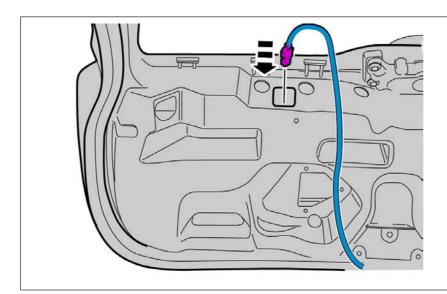


Connect the connector.


TJ Instruction 27989-1 Page 5 (11)

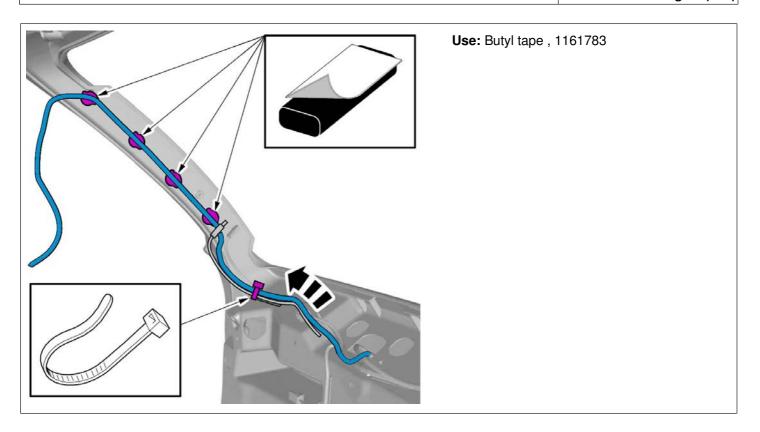


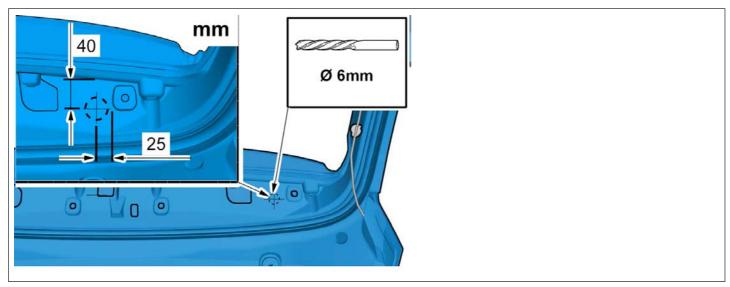


TJ Instruction 27989-1 Page 6 (11)

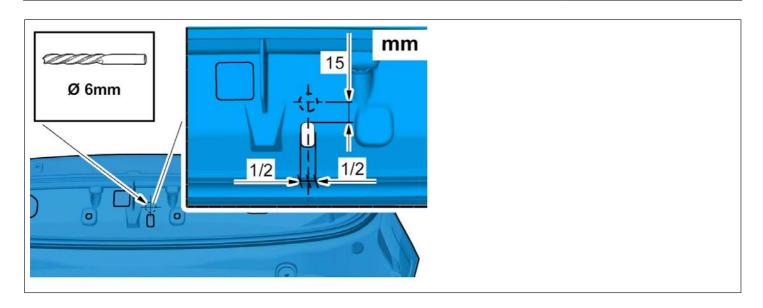


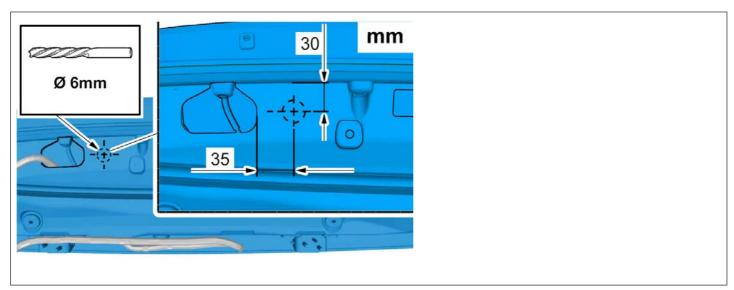


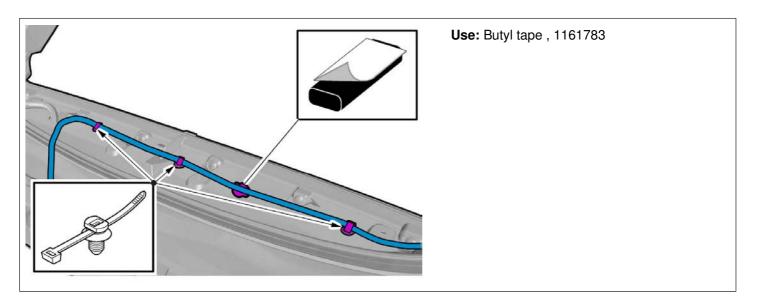


TJ Instruction 27989-1 Page 7 (11)

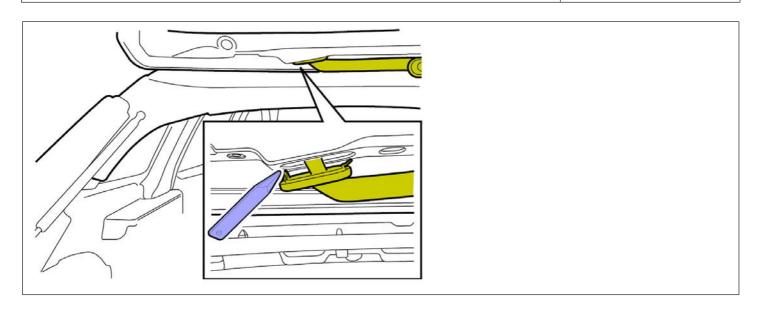


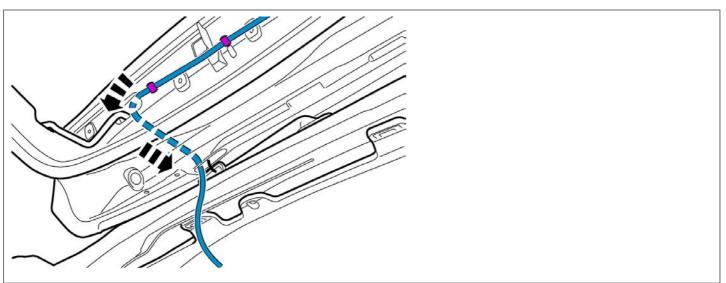


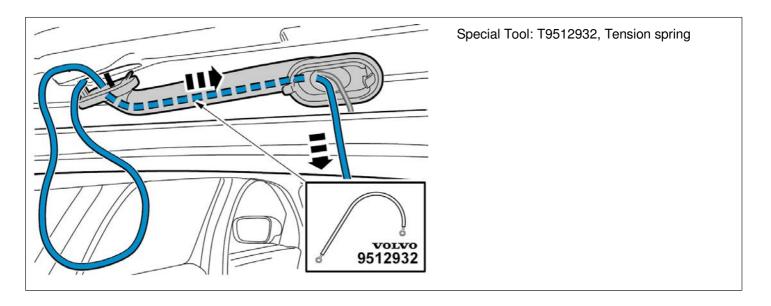

TJ Instruction 27989-1 Page 8 (11)

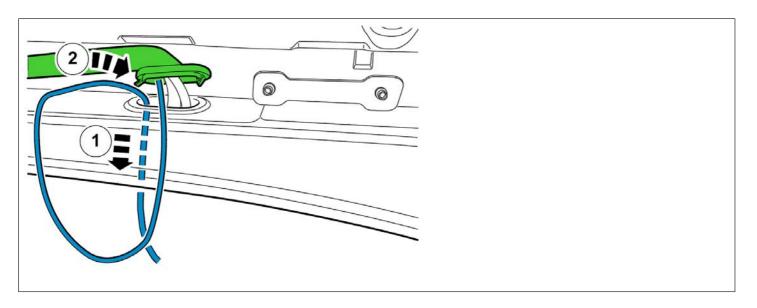


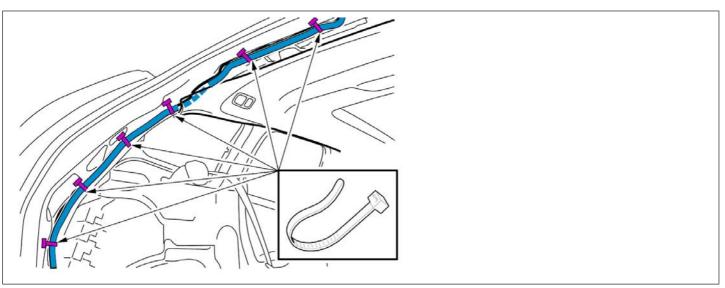


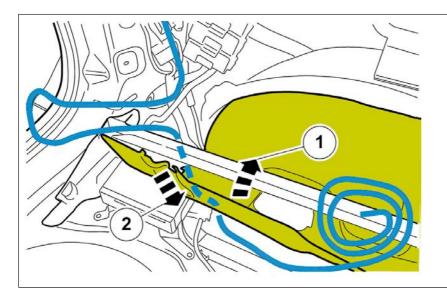


- 1 . Fold the insulation to one side.
- 2 . Route the cable harness to the existing cable harness.


TJ Instruction 27989-1 Page 9 (11)

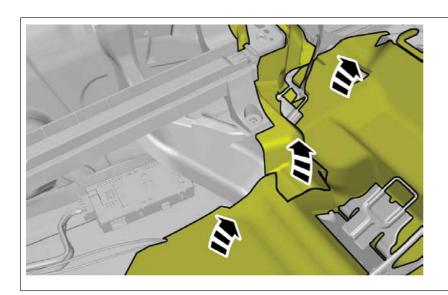


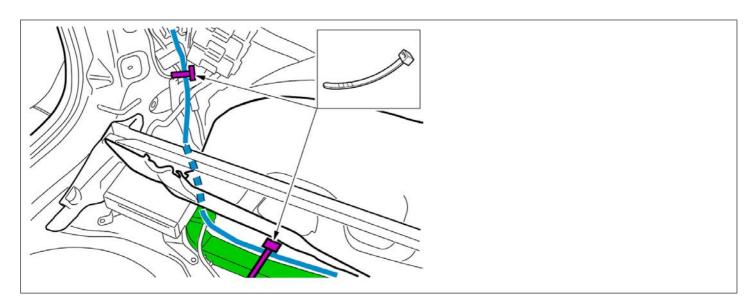

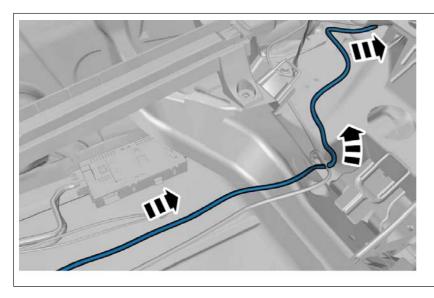



TJ Instruction 27989-1 Page 10 (11)

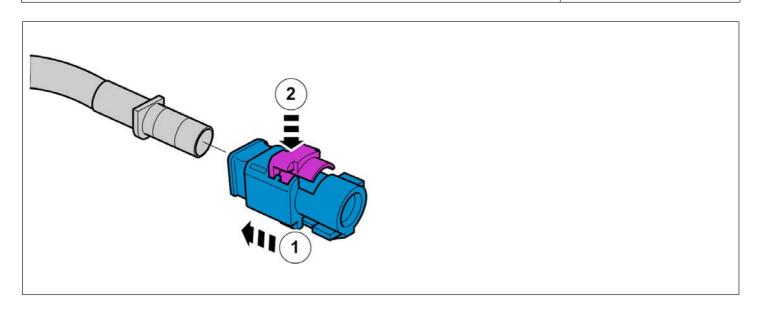

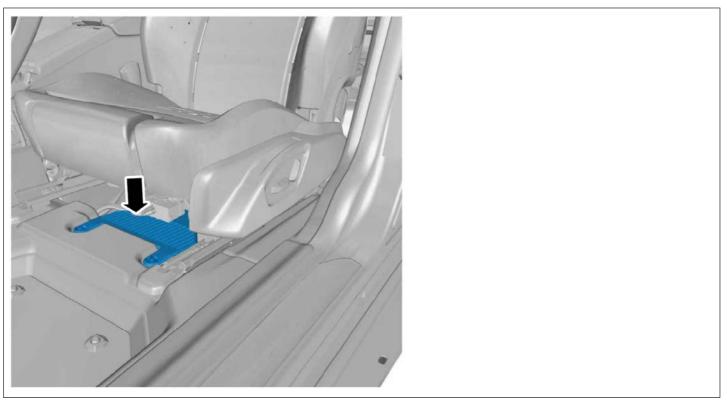

TJ Instruction 27989-1 Page 11 (11)

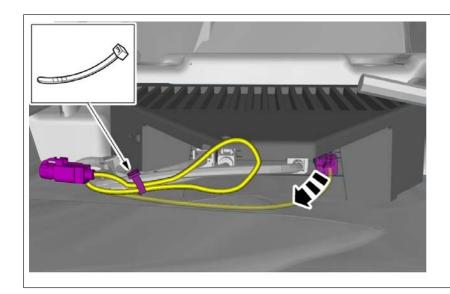

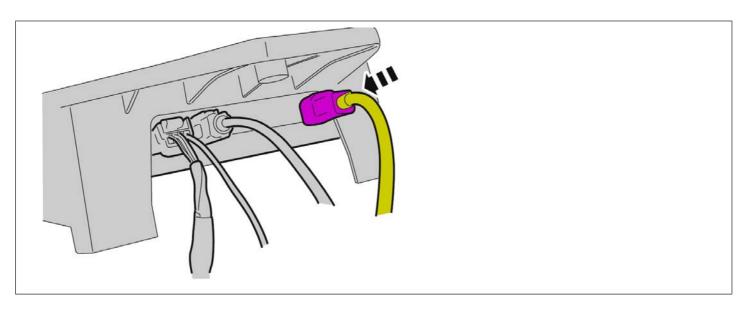

To install, reverse the removal procedure.

Volvo Car Customer Service TJ Instruction 27989-2

Title	Cable harness parking aid camera rear.	Page	1 (7)
Action	Replacement	Operation number:	98508-2

Issue	Date	Reason
1	2013-12	First issue

Affected vehicles


Model year	Model
2011, 2012,	S60 (11-)
2013, 2014	

Materials


Materials	Qty.	Part No.	Notes
Sems screw	4.0	987486	
Harness	1.0	31414655	
Cable tie	17.0	982635	

TJ Instruction 27989-2 Page 2 (7)

Orientation view

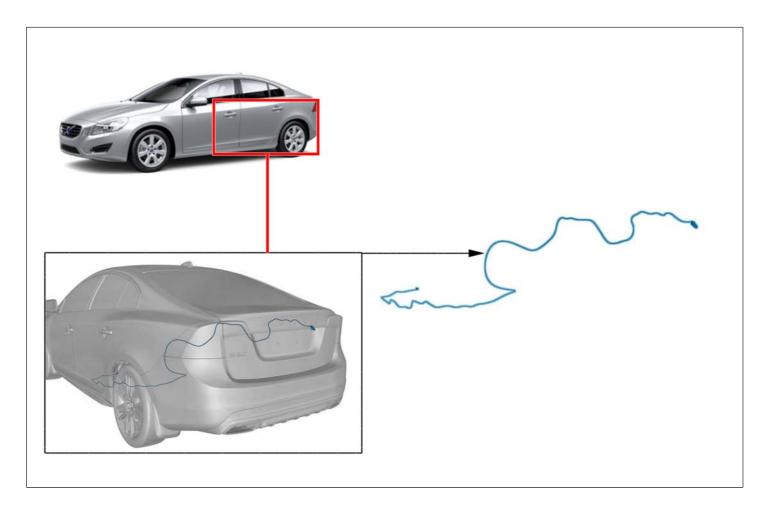

Color symbols

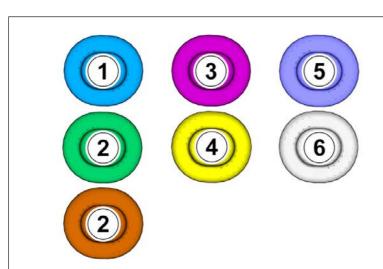

Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- 1 . Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5. Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

TJ Instruction 27989-2 Page 3 (7)

Detach left front seat, refer to:


Removal, replacement and installation

8 - Body and interior

85 - Interior

 $852\mbox{ -}$ front seat, drivers seat, seat bench

type

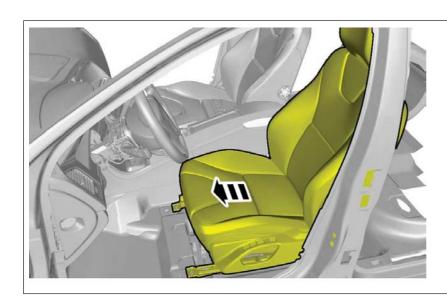

Detach left panel b-pillar, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

851 - upholstery for wall/door, side, rear

shelf, luggage rack

Remove the left-hand side panel in the cargo compartment, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

855 - other upholstery

Remove the seat cushion, rear seat, refer to:

Removal, replacement and installation

8 - Body and interior

85 - Interior

853 - rear seat, passenger seat, bench

TJ Instruction 27989-2 Page 4 (7)

Remove panel, tailgate, refer to:


Removal, replacement and installation

8 - Body and interior


85 - Interior

851 - upholstery for wall/door, side, rear

shelf, luggage rack

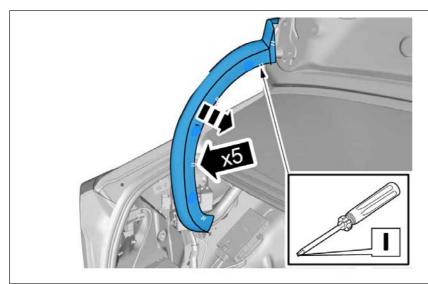



Caution! Take extra care when handling the component.

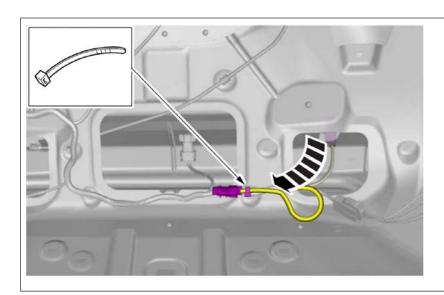


TJ Instruction 27989-2 Page 5 (7)

Installation

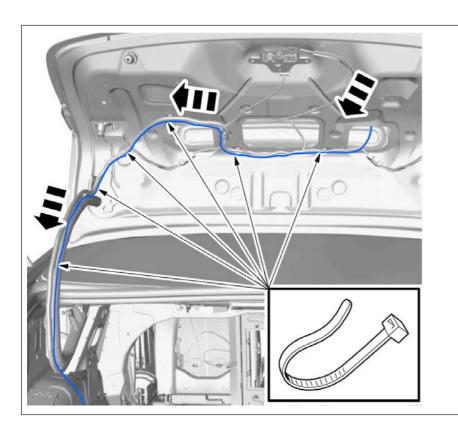


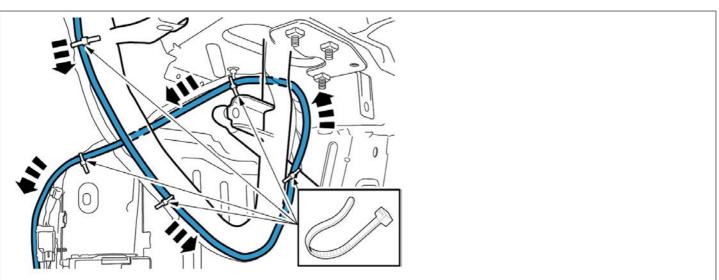

TJ Instruction 27989-2 Page 6 (7)

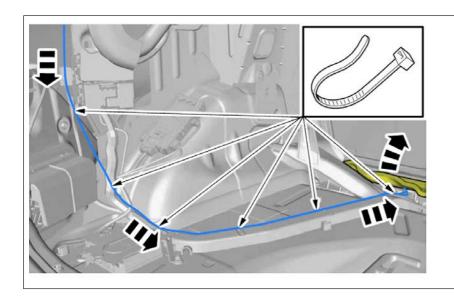




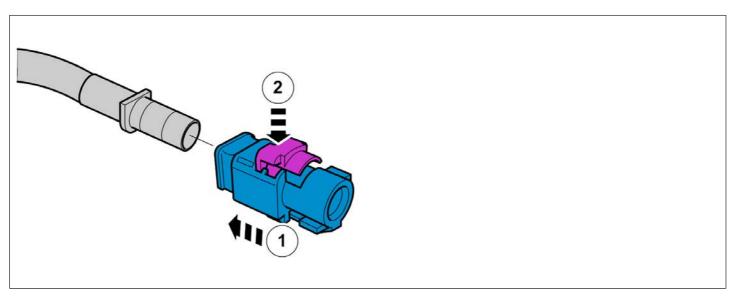

TJ Instruction 27989-2 Page 7 (7)



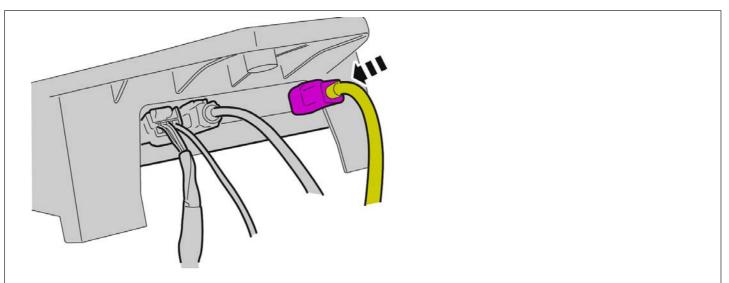

To install, reverse the removal procedure.