



**NUMBER:** 18-046-13  
**GROUP:** Vehicle Performance  
**DATE:** October 03, 2013

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.*

**HELP USING THE wiTECH DIAGNOSTIC APPLICATION FOR FLASHING AN ECU IS AVAILABLE BY SELECTING "HELP" THEN "HELP CONTENTS" AT THE TOP OF THE wiTECH DIAGNOSTIC APPLICATION WINDOW.**

**THE wiTECH SOFTWARE LEVEL MUST BE AT RELEASE 14.01 OR HIGHER TO PERFORM THIS PROCEDURE.**

**SUBJECT:**

Flash: MIL Illumination P0456- Evap System Small Leak. Also Includes Various Driveability Enhancements

**OVERVIEW:**

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software.

**MODELS:**

2013 (PF) Dart

**NOTE: This bulletin applies to vehicles equipped with a 2.0L engine (sales code ECK) and a Manual Transmission (sales code DE1) built on or before September 9, 2013 (MDH 0909XX).**

**SYMPTOM/CONDITION:**

A small number of customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the Technician may find that the following Diagnostic Trouble Code (DTC) has been set:

- P0456 - Evap System Small Leak

Customers may also experience any of the following conditions:

- Engine may be difficult to start and/or re-start when operating in temperatures below 32°F(0°C)

**Driveability Enhancements** are also included with this software release. These changes include the following:

- Improved evap purge strategy under high ambient temperatures

Updating the PCM software will correct the conditions listed above.

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If DTC's other than the ones listed above are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

**REPAIR PROCEDURE:**

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the PCM with the latest software. Help using the wiTECH Diagnostic Application for flashing control modules is available through the wiTECH Diagnostic Application. For instructions select the "HELP" tab on upper portion of the wiTECH window, then "HELP CONTENTS". This will open the Welcome to wiTECH Help screen where help topics can be selected.
2. **After PCM reprogramming, the following must be performed:** clear any DTC's that may have been set in other modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow the tech to clear them.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-19-06-W9	Module, Powertrain Control (PCM) - Reprogram (1 - Semi-Skilled)	8 - Engine Performance	0.2 Hrs.

**FAILURE CODE:**

FM	Flash Module
----	--------------