

Applies To: **2011–12 Insight – ALL****September 24, 2013**

MIL Comes On With DTC P0139

SYMPTOM

The MIL comes on with DTC P0139 (secondary heated O2 sensor slow response).

POSSIBLE CAUSE

The PCM misinterprets secondary heated O2 sensor signals and sets DTC P0139.

CORRECTIVE ACTION

Update the PGM-FI software.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number: 125517

Flat Rate Time: 0.2 hour

Failed Part: P/N 37820-RBJ-L45

Defect Code: 03214

Symptom Code: 03203

Skill Level: Repair Technician

SOFTWARE INFORMATION

HDS Software Version:
3.009.011 **or later.**

HDS Control Module (CM) Update:
Database Update 16-May-2013 **or later.**

Year/Model	Program ID (or later)	Program P/N (or later)
2011 Insight KL-ALL	BJL440	37805-RBJ-L44
2012 Insight KL-DX/LX	BJL040	37805-RBJ-L04
2012 Insight KL-EX/EX Navi	BJL130	37805-RBJ-L13

REPAIR PROCEDURE

Update the PGM-FI software with the MVCI. Refer to *Service Bulletin 01-023, Updating Control Units/Modules.*