



File in Section: -

Bulletin No.: PI1135

Date: December, 2013


Service Bulletin

PRELIMINARY INFORMATION

Subject: Service Rear Axle Message Displayed on Drivers Information Center (DIC), DTC C0407 Set

Models: 2014 Chevrolet Corvette Equipped with Electronic Limited Slip Differential (ELSD)
Condition/Concern

Some customers may comment on a service rear axle message displayed on the drivers information center (DIC).

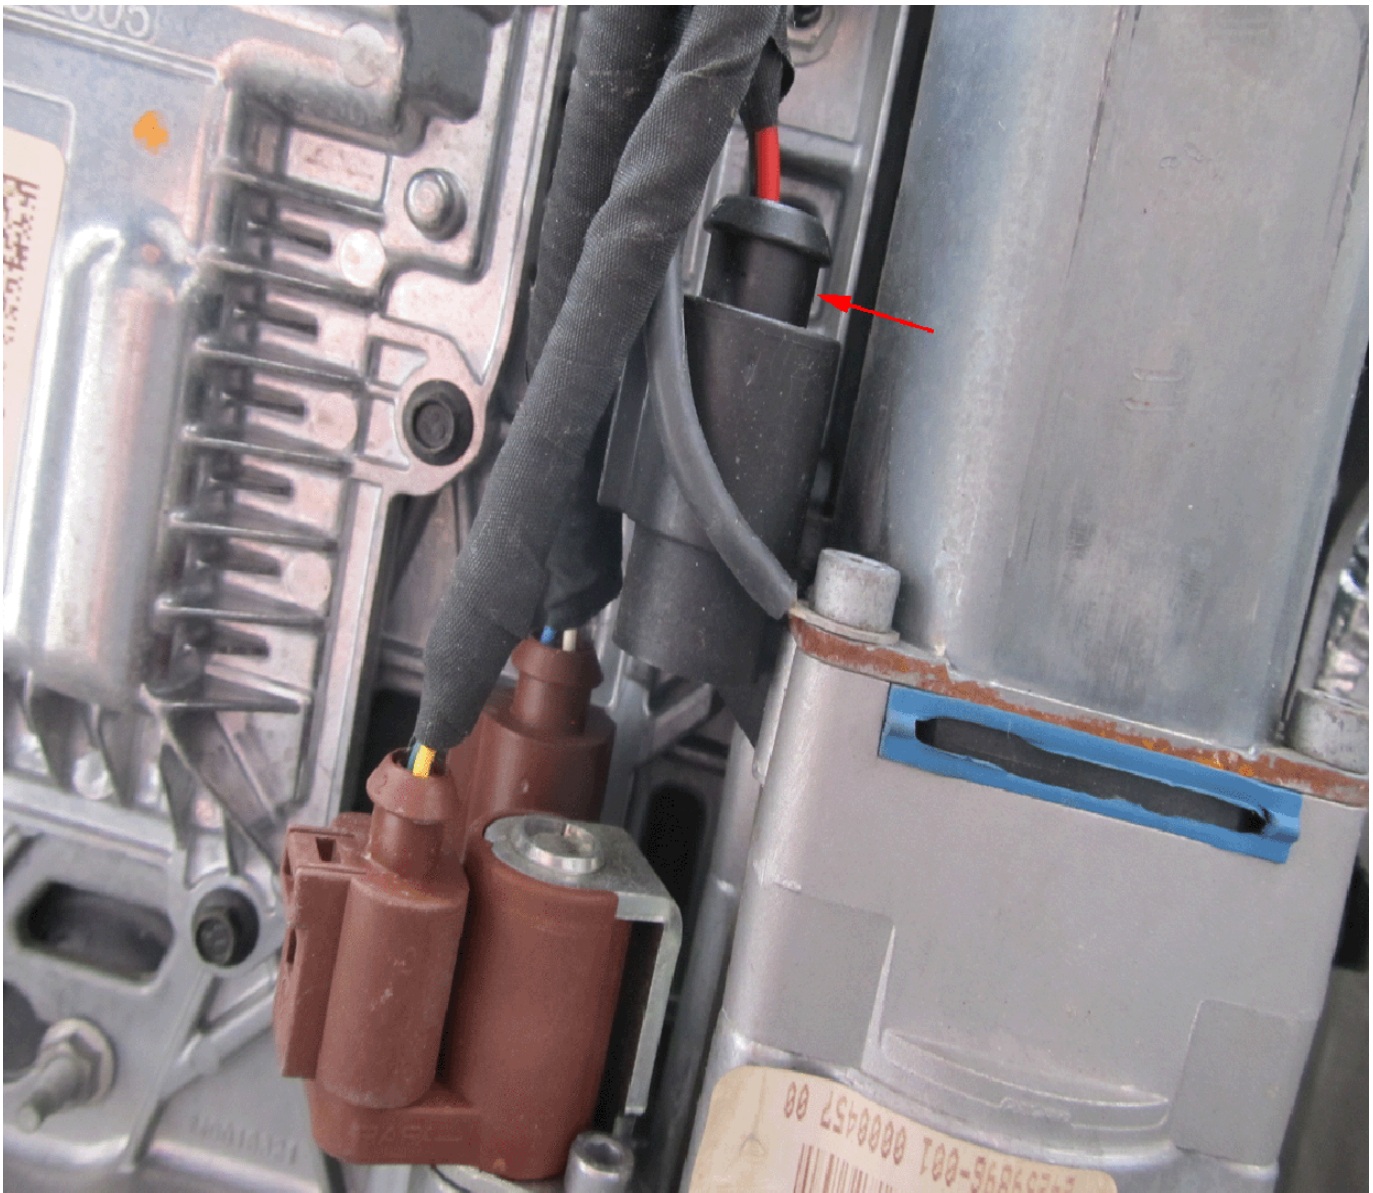

3665321

Technicians may find DTC C0407 set due to the connector on the pump motor, located behind the lower edge of the rear fascia, not properly seated as shown in the illustration above.

Recommendation/Instructions

Technicians should perform the following inspection:



3665323

- Inspect the connector to see if a white dot is present as shown in the illustration above. If a white dot is on the connector, follow SI for further diagnostic procedures. The connector has already been inspected at the plant.
- If the connector doesn't have a white dot, inspect and fully re-seat if loose, then clear any DTCs set or in history.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430922	Connector Reconnection	Use Published Labor Operation Time