

PREVOST

WARRANTY BULLETIN

WB13-56

DATE :	SEPTEMBER 2013	SECTION :	12 - Brakes
EXPIRATION:	SEPTEMBER 2015		
SUBJECT :	AIR LEAK ON AIR DRYER PROBE		

APPLICATION

NOTICE TO SERVICE CENTERS

*Verify vehicle eligibility by checking warranty bulletin status with **SAP** or **Vehicle Warranty Information** tool found on Prevost–Systems tab of the Volvo Trucks Dealer Portal*

Model	VIN
H3-45 coaches Model Year : 2013	Single vehicles: 2PCH33499DC71 2364 , 2PCH33492DC71 2366 , 2PCH33496DC71 2371 2PCH33498DC71 2372 , 2PCH33491DC71 2374 , 2PCH33493DC71 2375 2PCH33497DC71 2377 , 2PCH33490DC71 2379
H3-45 VIP Motorhomes Model year : 2013	Single vehicles 2PCVS349XDC71 2248 , 2PCVS3492DC71 2373
LeMirage XLII Entertainers Model Year : 2013	Single vehicle 2PCYS3492DC73 5374

This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

On the vehicles affected by this bulletin, the air dryer assembly may present a leak at the pressure probe connection. The O-ring in this location may be deformed due to the fitting arrangement. Adding a metal ring will prevent this issue.

MATERIAL

Order the following parts:

Part No.	Description	Qty
504789	Ring	1
OR		
641294	Male fitting / JIC 37° / #8JIC-MxM16-1.5-M	1

NOTE

Material can be obtained through regular channels.


PROCEDURE




DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.


1. Lift vehicle
2. Release air pressure by front service compartment drain valve.
3. Air dryer may be located in one of these three locations :
 - A. Above drive axle, left side
 - B. In Spheros preheater compartment.
 - C. In last luggage compartment on the aft wall.

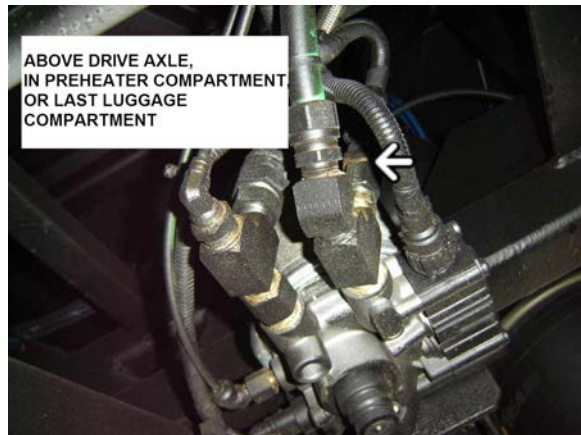

4. Disconnect and unscrew the probe, leaving the fitting on the air dryer (unscrew only the probe).

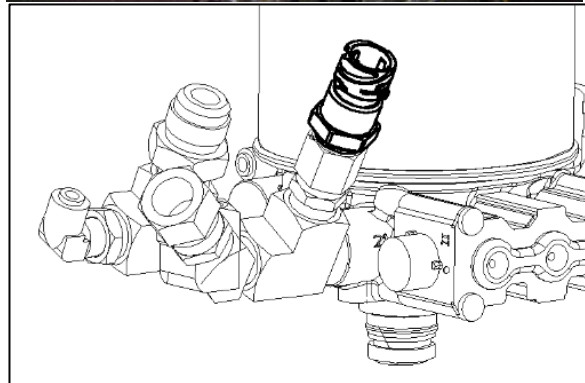


5. If you have fitting 641294, take this ring to install on the probe.

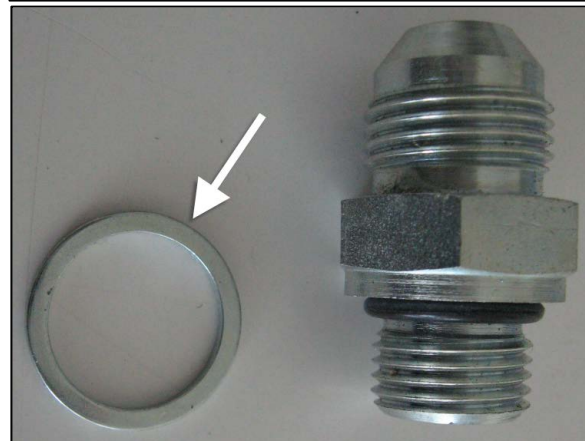

6. Add ring 504789 at arrow location and re-install probe on air dryer assembly.

7. Reconnect probe and verify for air leaks.
Ensure system operates correctly.

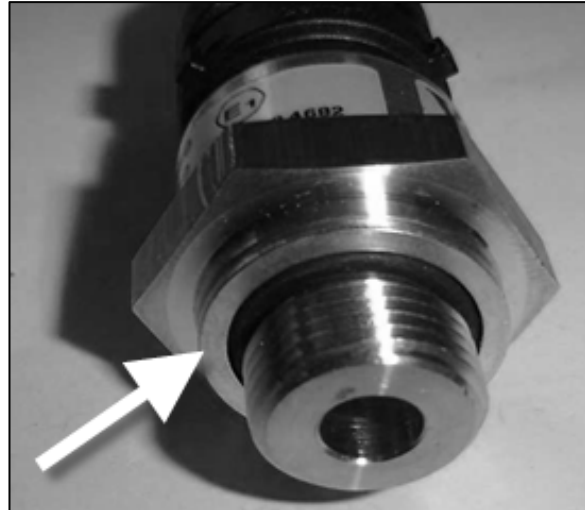

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and one half hour (30min) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin WB13-56".

OTHER

VBC Bulletin	N/A
Fail Code	12.06
Defect Code	09
System Condition	B
Causal Part	20829689

Access all our Service Bulletins on <http://prevostparts.volvo.com/technicalpublicatios/en/pub.asp>
Or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type "ADD" in the subject to receive our warranty bulletins by e-mail.





PREVOST

**MAINTENANCE
INFORMATION**

MI13-59

DATE :	SEPTEMBER 2013	SECTION :	12 - Brakes
SUBJECT :	ANTILOCK BRAKING SYSTEM (ABS) & ELECTRONIC STABILITY CONTROL (ESC) SYSTEM CHECK		

IMPORTANT NOTICE

This procedure is recommended by PrevoSt to increase your vehicle's performance. Note that no reimbursement will be awarded for carrying out this maintenance.

APPLICATION

Model			
ALL PREVOST VEHICLES, STARTING FROM			
H3-41 coaches:	2PCH334138C711078	X3-45 coaches:	2PCG334928C729282
H3-45 coaches:	2PCH334928C711045	XLII Entertainer:	2PCY334978C729279
H3-41, H3-45 VIP:	2PCV334937C710942	XLII-45 Motorhomes:	2PCW334988C729332

DESCRIPTION

PrevoSt recommends checking for proper functioning of the antilock braking system (ABS) & electronic stability control (ESC) system using Bendix ACom Diagnostics software.

Bendix ACom Diagnostics software provides the technician with access to all the available EC-60 ABS ECU diagnostic information and the ability to perform ABS/ESC component tests, including M-32QR Pressure Modulator Valve.

When using ACom Diagnostics software to diagnose the EC-60 ABS ECU, the computer's USB port needs to be connected to the vehicle's diagnostic connector.


For the latest information, and for free downloads of the Bendix ACom Diagnostics software, and its User Guide, visit the Bendix website at www.bendix.com.

SERVICING SCHEDULE	
DESCRIPTION	FREQUENCY
Check proper functioning of ABS and ESC systems using Bendix ACom Diagnostics software	12 months

Access all our Service Bulletins on
<http://prevostparts.volvo.com/technicalpublicatios/en/pub.asp>
Or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type "ADD" in the subject to receive our warranty bulletins by e-mail.



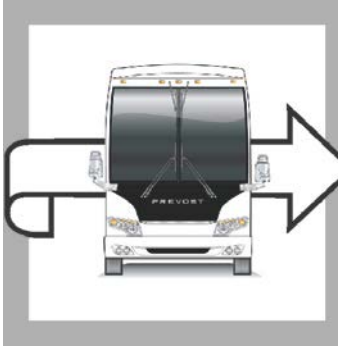


PREVOST

WARRANTY BULLETIN

WB13-62

DATE :	SEPTEMBER 2013	SECTION :	10 - Front axle
EXPIRATION:	SEPTEMBER 2015		
SUBJECT :	TORQUE INSPECTION ON FRONT AXLE SUPPORT BOLT		

APPLICATION

NOTICE TO SERVICE CENTERS <i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
X3-45 coaches Model Year : 2011 - 2014	 From 2PCG33499 <u>B</u> C72 <u>9965</u> up to 2PCG33494 <u>E</u> C73 <u>5502</u> incl.
<p>This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.</p>	


DESCRIPTION

On the vehicles affected by this bulletin, torque must be verified on one of the axle support mounting bolts.

MATERIAL

No material is needed for this warranty bulletin

PROCEDURE


 DANGER
<p>Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.</p>

1. On the front axle, left side (driver's side). Locate this bolt (arrow).


2. Verify the torque on this bolt.

Value should be

255 +/- 25 lbf-ft. (**230 - 280** lbf-ft).

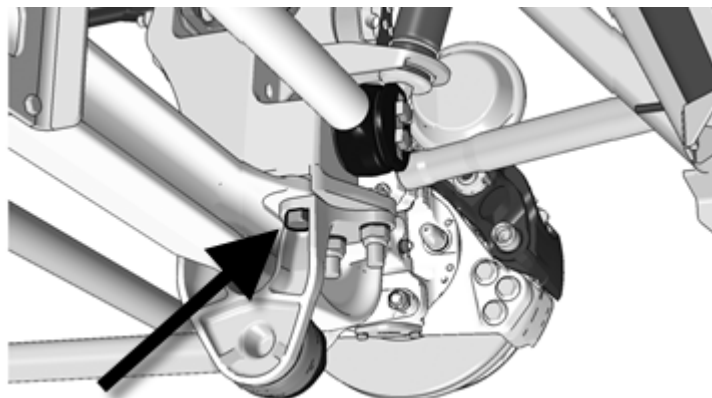

3. If torque is outside the required range, unscrew half a turn and tighten to 255 lbf-ft.

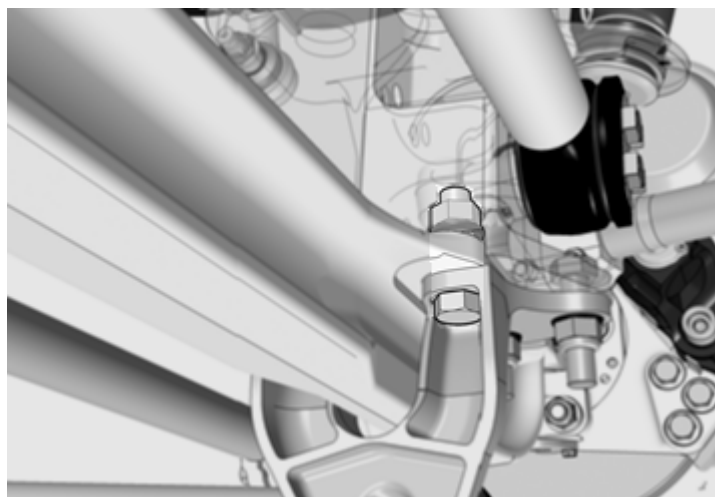

PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevo's normal warranty. We will reimburse you three quarters of an hour (45min) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevo.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB13-62".

OTHER

VBC Bulletin	N/A
Fail Code	10.00
Defect Code	09
Syst.Cond.	B
Causal Part	5001510

Access all our Service Bulletins on <http://prevo.com/technicalpublications/en/pub.asp> or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type "ADD" in the subject to receive our warranty bulletins by e-mail.

