

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR NOVEMBER 2013**

44280 2013 F-150 3.5L GTDI - Possible MIL On With Diagnostic Trouble Codes P00C2 and P0340  
May Also Be Accompanied By P2228

2013 F-150 3.5L GTDI with a possible Malfunction Indicator Lamp (MIL) on and Diagnostic Trouble Codes (DTC) P00C2 and P0340 may also be accompanied by P2228 in the Powertrain Control Module (PCM). This may be due to NON-FORD Aftermarket PCM software program installed in the PCM. To confirm the vehicle has a Ford Production calibration installed review the PCM calibration filename located in the IDS vehicle log file. The filename (Identified in IDS as PCM\_FILENAME) must begin with the prefix letter "D" to be a valid FORD production level calibration. If the filename indicates a different prefix letter advise the customer that Per the vehicle's Warranty Guide and the Warranty and Policy Manual the repair is not covered under the vehicle's warranty and the customer should contact the aftermarket calibration vendor for repair direction.