

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR NOVEMBER 2013**

44282 2010-2014 F150 - 3.5L/5.0L/6.2L - Exhaust Torca× Clamp Available For Service -  
nformation Only

When performing repairs that require removal and installation of the left and/or right side catalyst assemblies, the Torca× clamp that secures the two catalyst pipes may require replacement due to stretching from repeated use. If the Torca× clamp is no longer providing the necessary clamping force to seal the exhaust joint, the Torca× clamp can now be replaced using service part# 2L1Z-5A231-AA . The spot weld securing the old Torca× clamp can be ground off and the clamp replaced. When installing the new clamp, be sure that the clamp opening is towards the front of the vehicle and the draw bolt orientation is vertical.