

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR NOVEMBER 2013**

44287 2013 C-Max, 2013-2014 Escape, Focus - Body Control Module Ground, DTC U3008:13

Some 2013 C-Max, 2013-2014 Escape and Focus vehicles may exhibit DTC U3008:13 in Body Control Module (BCM). If DTC is present, a BCM ground issue exists and must be given priority over other DTCs or symptoms. A poor ground can cause low voltage to BCM, which could cause erratic, intermittent operation of several electrical components. Check ground circuits G107 and G301 on Focus and C-Max, G103 and G200 on Escape. To verify integrity of these ground circuits, use a suitable bulb to place load on circuits and measure voltage drop. With load present, manipulate wiring harness to check for intermittent fault. Repair any circuit that drops greater than 0.3 volts and re-test. Check pin fit in all BCM connectors with a flex probe. BCM replacement will result in repeat repair if ground issue is left unresolved.