



Connection offline

Technical product information

Topic	Rear body controller - tail lamp related fault codes
Market area	Worldwide Bentley (1WBE)
Brand	Bentley
Transaction No.	2034099/1
Level	EH
Status	Approval
Release date	

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
46 - Central Module Comfort System	00984: Left tail light -M4	9: Open circuit/short circuit to ground	Intermittent
46 - Central Module Comfort System	00985: Right tail light -M2	9: Open circuit/short circuit to ground	Intermittent
46 - Central Module Comfort System	00987: Bulb for left brake light -M9	9: Open circuit/short circuit to ground	Intermittent
46 - Central Module Comfort System	00988: Bulb for right brake light -M10	9: Open circuit/short circuit to ground	Intermittent

New customer code

Object of complaint	Complaint type	Position
Lighting system, signalling -> Exterior illumination -> Brake lights	component / consumables -> flickering	

New workshop code

Object of complaint	Complaint type	Position
Lighting system, signalling -> Operation, control, light control -> Lamp control control unit	control units, services -> software faulty	

Vehicle data

Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4W21*	2014	E		*	*	*

Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
SCB	***	**	*	E	C		999999		

Documents

Document name
master.xml



Connection offline

Technical product information

Transaction No.: 2034099/1

Rear body controller - tail lamp related fault codes

Customer statement / workshop findings

The customer will not be aware that these fault codes have been recorded. Dealer personnel may observe tail lamp related fault codes during routine diagnostic sweep of the rear body control module

Technical background

Four specific sporadic fault codes may be recorded in the rear body controller. These codes are detailed below and can be triggered simply as a result of system voltage dipping and then raising during the normal engine crank sequence.

Production change

New software under development

Measure

In the event that any of the following sporadic fault codes are displayed in the rear body control module and no other symptoms are present then clear the codes and take no further action

Code	Description
00984	Left tail lamp – M4
00985	Right tail lamp – M2
00987	Bulb for left brake light – M9
00988	Bulb for right brake light – M10