

© 2013 Mazda Motor of America, Inc.


Subject: MAZDA RADAR CRUISE CONTROL (MRCC) WARNING LIGHT ON WITH DTC C1A67:92	Bulletin No: 01-014/13
	Last Issued: 06/14/2013

APPLICABLE MODEL(S)/VINS

2014 Mazda6 vehicles with VINs from JM1 GJ ***** 103113 to JM1 GJ ***** 112154 (produced from December 3, 2012 to February 21, 2013)

DESCRIPTION

Some vehicles may experience a Mazda Radar Cruise Control (MRCC) warning light on with DTC C1A67:92 (Radar sensor sensitivity lowered). FOW, MRCC Radar blocked message will be displayed in the Instrument Cluster Multi-Information Display.

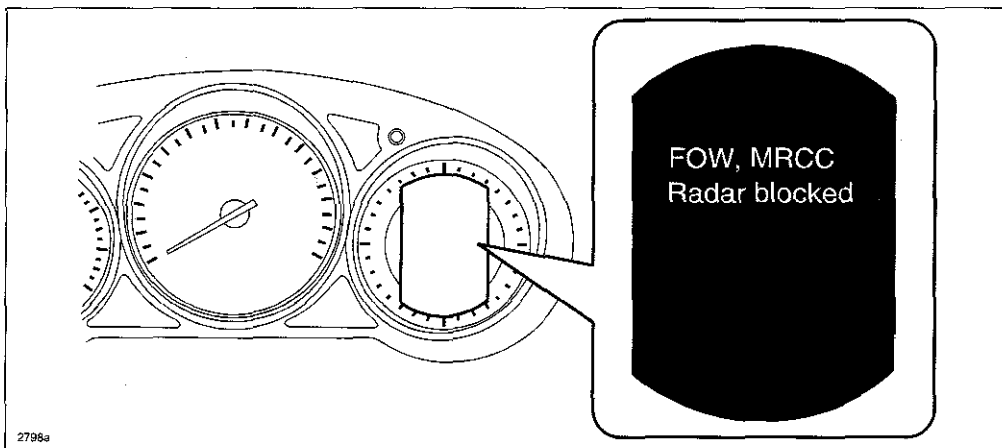


Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Perform Workshop Manual diagnosis per MS3 online or Workshop Manual (section 01-02 DTC C1A67:92 [VEHICLE CONTROL MODULE (V/C-MODULE)]).
3. Did Step 2 diagnosis repair the customer concern?
 - a. Yes - This service bulletin does not apply.
 - b. No - Proceed to Step 4.

4. Replace the radar sensor unit (A) and perform the radar sensor aiming adjustment per MS3 online or Workshop Manual section 01-20:
 - RADAR SENSOR REMOVAL/INSTALLATION [MAZDA RADAR CRUISE CONTROL (MRCC) SYSTEM].
 - RADAR SENSOR AIMING [MAZDA RADAR CRUISE CONTROL (MRCC) SYSTEM].

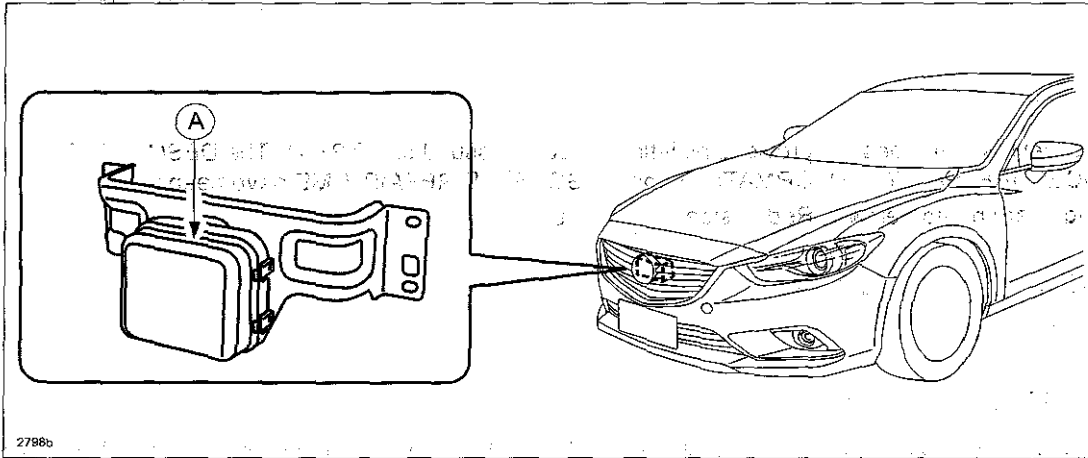

5. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
GHP9-67-XA1A	Radar Sensor Unit	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	61
Damage Code	9w
Part Number Main Cause	GHP9-67-XA1A
Quantity	1
Operation Number / Labor Hours:	XXJ6PXRX / 0.7 Hrs.