

## **Technical Service Bulletin**

GROUP MODEL **CAMPAIGN** 

**GENESIS COUPE (BK)** 

DATE

NUMBER

**MARCH 2013** 

13-01-013

SUBJECT: GENESIS COUPE (BK) 3.8L ECM UPDATE - (SERVICE CAMPAIGN TM8)



NOTE: THIS TSB REVISION SUPERSEDES TSB 12-01-041 TO INCLUDE RETAIL VEHICLES

#### \* IMPORTANT

## \*\*\*\*\*DEALER STOCK AND RETAIL VEHICLES\*\*\*\*\*

Dealers must perform this Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

This bulletin provides information for an ECM software update of some Genesis Coupe (BK) 3.8L incident vehicles.

## Applicable Vehicles:

- 13 MY Genesis Coupe(BK) 3.8L GDI vehicles
- Production Date: SOP through October 23, 2012

#### **GDS** Information:

EVENT#	DESCRIPTION
282	"BK 3.8 GDI CYLINDER IMBALANCE DTC LOGIC IMPROVEMENT."

#### **Warranty Information:**

Model	Op Code	Operation	Op Time
GENESIS COUPE (BK)	20C112R1	ECM UPGRADE	0.3M/H


#### **ROM ID INFORMATION TABLE:**

Verify the ECM ROM ID before updating the vehicle's software. Refer to the table below.

Model		ECM P/N	T/M	ІММО	ECM ROM ID	
	Engine				Previous	New
GENESIS COUPE (BK) 3.8 GDI		39115- 3CKN0	8AT	Yes (push button start)	BKCN38GM2**CK7A* BKCN38GM2**CK7B*	BKCN38GM2**CL1A*
	39105- 3CKN0		No (key start)	BKCN38GS2**CK7A* BKCN38GS2**CK7B*	BKCN38GS2**CL1A*	
	3.8 GDI	39116- 3CKN0	6МТ	Yes (push button start)	BKCN38GM2M6CK7A* BKCN38GM2M6CK7B*	BKCN38GM2M6CL1A*
		39106- 3CKN0		No (key start)	BKCN38GS2M6CK7A* BKCN38GS2M6CK7B*	BKCN38GS2M6CL1A*

#### **GENERAL PRECAUTIONS:**

- Connect the USB cable between the GDS and the VCI.
- Connect the 16-pin DLC connector from the VCI into the DLC located under the driver's side dash.

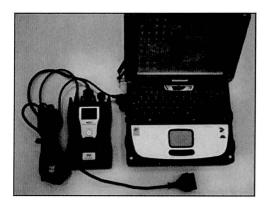

## **★** NOTE

Make sure the battery icon at the bottom right of the GDS laptop shows at least 50%; if not, charge the GDS or attach a battery charger.

- Turn off all lights (Do not leave the headlight switch in auto mode) and all accessories (including heater/air conditioner/fan, audio, heated seats, rear defroster, etc) to ensure the battery will not be discharged during the update.
- Perform the update with the ignition key in the ON position.
- Do not disconnect any cables connected to the vehicle or the GDS during the update.
- Do not start the engine or turn the ignition switch OFF during the update.

TSB #: 13-01-013 Page 2 of 4

## SUBJECT: GENESIS COUPE (BK) 3.8L ECM UPDATE - SERVICE CAMPAIGN TM8

## \* NOTE

Confirm your GDS has the most recent version. If not, connect the GDS to an Internet port, open the GDS home page and select "Update". Refer to instructions on hmaservice.com if necessary.

If you encounter GDS related problems, call the GIT Helpline at 888-437-0308.


#### **SERVICE PROCEDURE:**

#### GDS AUTO MODE ECM UPDATE PROCEDURE

- 1. From the GDS home page, select ECU Upgrade. If necessary, select the VIN.
- 2. Select Engine as the system and then select OK.
- 3. Select Auto Mode and then select Next.
- 4 From the **System** tab, select **Engine** and then select **OK.** The GDS will read the ROM ID. Confirm the ROM is applicable as shown on Page 1, "ROM ID Information".



5 Select update event as listed on the GDS Event list of page-1. Select Upgrade.

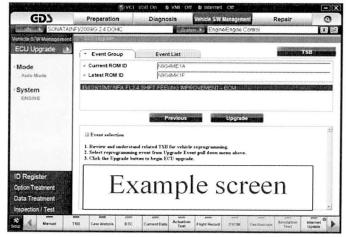

- 6 If the screen indicates "Voltage is OK" (voltage > 12volts), select OK. If not, select CANCEL and charge the vehicle battery by running the engine for 10 minutes.
- 7 Updating will occur until 100% is reached on the bar graph. At the prompt, turn the ignition key OFF for 10 seconds, then turn it ON and select **OK**.
- 8 The GDS will confirm that ECM reprogramming is successfully finished. Select **OK**.
- 9 If the ECM update was not successful, go to GDS MANUAL MODE ECM UPDATE

TSB #: 13-01-013 Page 3 of 4

# GENESIS COUPE (BK) 3.8L ECM UPDATE - (SERVICE CAMPAIGN TM8)

#### PROCEDURE.

SUBJECT:

- 10 Check for DTC in all systems and Erase All DTC that stored due to loss of CAN communication during the ECM Update.
- 11 Turn **OFF ignition 10 seconds** then turn **ON** before going to engine start.
- 12 Start the engine to confirm proper operation.

## \* NOTE:

In event of AUTO MODE update failure:

- You must attempt MANUAL MODE. Use the ECM P/N from the vehicle's ECM label if it is not clear from the ROM ID Table as to the correct ECM P/N to use for your vehicle.
- Replacing an ECM without carefully documenting that a MANUAL MODE update attempt was made, will result in claims charge back.

## GDS MANUAL MODE ECM UPDATE PROCEDURE

## \* NOTE

- GDS Manual Mode is intended for recovery of an ECM Update should it begin but then later fail in process in the Auto Mode.
- The ECM connectors must be disconnected for 15 minutes to reset its contents then perform this Manual Mode Update.
- Do not force Manual Mode if you get an error in Auto Mode that the vehicle's current ROM ID did not apply.
- It is critical to identify the correct ECM Part Number in the PASSWORD table or the ECM may be permanently damaged. It is recommended to remove ECM and read the part number from the label to confirm.
- 1. From the GDS home page, select **ECU Upgrade**. If necessary, select the VIN.
- 2. Select Engine as the system and then select OK.
- 3. Select Manual Mode and then select Next.
- 4 From the **System** tab, select **Engine** and then select **OK**.
- 5 Select update event as per the GDS Event List of page-1, then select Upgrade.
- 6 Be certain to enter the exact appropriate password from the table on the next page and select **OK. See the important NOTE above.**
- 7 The remaining steps are same as Steps 6~12 of the Auto Procedure.

MENU	PASSWORD
BK 3.8 GDI 8AT IMMO : 39115-3CKN0	1530
BK 3.8 GDI 8AT NON IMMO : 39105-3CKN0	1050
BK 3.8 GDI 6MT IMMO : 39116-3CKN0	1630
BK 3.8 GDI 6MT NON IMMO : 39106-3CKN0	1060

TSB #: 13-01-013 Page 4 of 4