	GROUP	NUMBER			
CO HYUNDAI NEW THINKING. NEW POSSIBILITIES	Campaign	13-01-038			
Technical Service Bulletin	DATE	MODEL(S)			
rechnical Service Bulletin	September 2013	2013 MY Santa Fe (NC)			
SUBJECT: OVERHEAD CONSOLE LA	ECT: OVERHEAD CONSOLE LAMP INSPECTION AND REPLACEMENT				
(SERVICE CAMPAIGN TQ4)					

*** Dealer Stock and Retail Vehicles ***	
	*** Dealer Stock and Retail Vehicles ***

Dealers must perform this Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

## DESCRIPTION:

This bulletin describes the procedure to inspect and/or replace the Santa Fe overhead console lamp.



### Applicable Vehicles: 2013 Model Year Santa Fe (NC)

Applicable Production Date Range: SOP - June 01, 2013

OP CODE	OPERATION	OP TIME	
30C044R0	Overhead Console Lamp & Sunglass holder Inspection	0.2 M/H	
30C044R1	Overhead Console Inspection and Replacement	0.3 M/H	

WARRANTY INFORMATION: Submit claim using the Campaign Claim Entry Screen.

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

### SUBJECT: OVERHEAD CONSOLE LAMP INSPECTION AND REPLACEMENT (SERVICE CAMPAIGN TQ4)

PART NAME	PART NUMBER		REMARKS	
Lamp Assembly - Overhead Console	92800B8000OMQQH	Grey color	W/ Power	
		92800B8000VYNQH	Beige color	Liftgate
	92800B8200OMQQH	Grey color		
		92800B8200VYNQH	Beige color	Sunroof
		928002W000OMQQH	Grey color	
		928002W000VYNQH	Beige color	Standard

#### Note:

Verify that the vehicle has an open Service Campaign using WEB DCS

## SERVICE PROCEDURE:

# OVERHEAD CONSOLE LAMP INSPECTION


 Check if any of the overhead console lamp hinges are broken.
Press on each of the 4 arrows of the overhead console lamp 5 times each.

> If there are any broken hinges; the plastic lens cover will not be flush with the rest of the console. Proceed to "OVERHEAD CONSOLE REPLACEMENT PROCEDURE".

#### Notice

When pressing the lens cover to activate the lights, if the lens do not move freely proceed to "OVERHEAD CONSOLE REPLACEMENT PROCEDURE".

If the light turns on and off without obstruction no further action is needed.

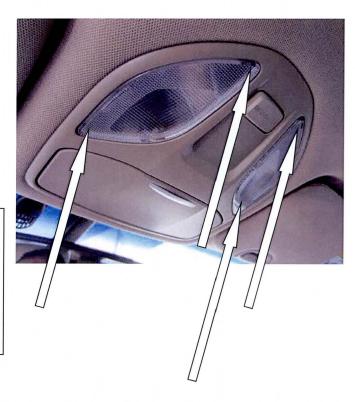

## SUBJECT: OVERHEAD CONSOLE LAMP INSPECTION AND REPLACEMENT (SERVICE CAMPAIGN TQ4)

 Press the 3 locations to verify free opening and closi ng of the sunglass holder.
If the opening and closing motion is free of obstruction. No further action is required.

### Notice

If the sunglass holder is not flush with the adjustment trim, or does not open and close freely, proceed to "OVERHEAD CONSOLE REPLACEMENT PROCEDURE ".



# OVERHEAD CONSOLE REPLACEMENT PROCEDURE

 Open the sunglass holder case and loosen the 2 overhead console mounting screws.



4. Separate the overhead console from the headliner by pulling the sunglass holder case downward.

# SUBJECT: OVERHEAD CONSOLE LAMP INSPECTION AND REPLACEMENT (SERVICE CAMPAIGN TQ4)

5. Disconnect the wire harness and remove the Overhead Console.



6. Install the replacement Overhead Console in reverse order of the removal.

Verify ALL the operations of the Overhead Console:

- Lights
- Door Ajar Switch
- Sunglass Holder
- Sunroof (if equipped)
- Sunshade (if equipped)
- Power Tailgate (if equipped)

