



Mercedes-Benz
The best or nothing.

star bulletin



Date: November 14, 2013
Order No.: P-B-58.40/163
Group: 58

**SUBJECT: MY-All, Model 222
Special Process for Obtaining Software Using Regio-DVD and DVD Digital
Owner's Manual**

NOTE: It is particularly important to update software for the new S-Class to meet customer expectations. See the instructions below for updating Regio-DVD.

Installation of Regio DVDs

From model series 222 onwards, the control unit software ("Flashware") will no longer be sent via telematics DVD/CD, but instead via the "Regio DVD". This will include the customary software, as well as control unit software which is too large for the regular diagnostic update data media.

You may order the DVD with the corresponding software version via the usual replacement part ordering process by entering the HLI number for USA.

There are two installation options:

1. Installation of the entire Regio data medium for your region, either directly after installation of the current diagnostic update or at a later stage.
2. Installation as required. If you have not installed the Regio DVD, however require certain software from it for programming purposes, a XENTRY Flash screen will appear and request that you insert the data medium immediately before programming of the control unit.

Installation Procedure

1. Installation on XENTRY Kit

Supply XENTRY Connect and the Blu-ray drive with power using the corresponding power supply unit.




→ XENTRY Connect

Note: Please only use the genuine power supply units that are intended for the devices.




→ Blu-ray drive


This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

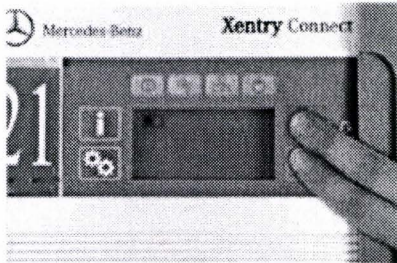Connect the Blu-ray drive to XENTRY Connect using the USB Y-cable supplied.	
Make sure the XENTRY Connect is in standby mode and then insert the Regio DVD. Start the installation by pressing the key combination on the XENTRY Connect operating panel (green tick + red cross). This will trigger the "Start update?" message. Press the green tick to confirm this message.	
The following symbol appears in the XENTRY Connect display once the installation is complete:	
Press the button with the green tick to complete the installation. The device will automatically switch off if the button is not activated within 5 minutes.	
Once the installation is complete, the XENTRY Connect can be started as normal and a connection made to it via XENTRY Control.	

2. Installation on Star Diagnosis

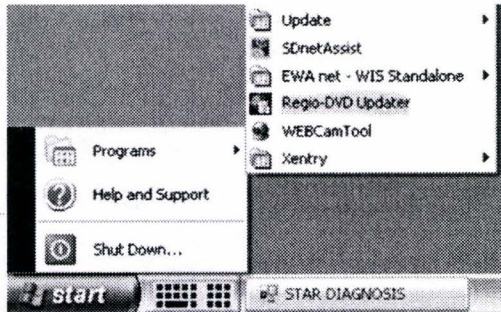
Connect the DVD drive to your Star Diagnosis device and insert the Regio DVD. Now start the "Regio DVD Updater" function under "Programs" in the start menu.	
--	--

Select "United States" from the list in order to start the installation. If you wish to save the selection for future processes, tick the box in the line below.

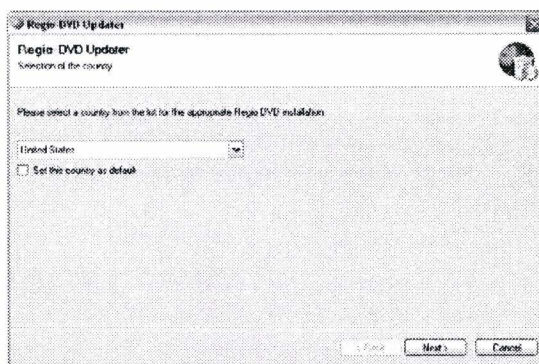


You will be requested to insert a Regio DVD with a specific HLI number into the drive.

If you do not insert a Regio DVD, an error message will appear on the screen with a repeated request to carry out this step. If you insert a Regio DVD with another HLI number, you will be asked whether you wish to continue the installation with this DVD. In this case, click on "No" and insert the correct DVD.

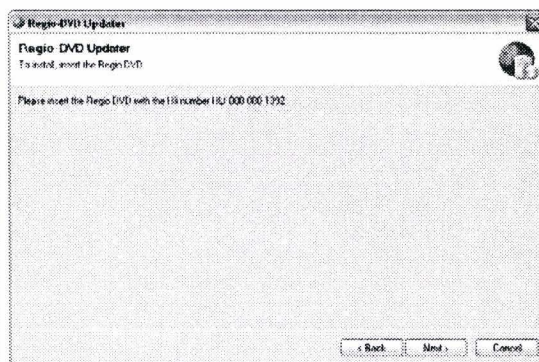

Progress of the installation will be shown on the screen using a green bar.

If the installation is interrupted, you will need to start the process again.

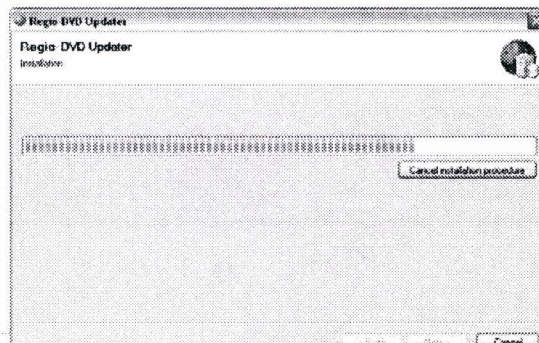

By clicking on "OK", the installation will come to an end and you may continue using your diagnostic device as normal.



Digital Owner's Manual DVD

The Digital Owners' Manual DVD (as of 5/20/2013) is ordered via Paragon. Before head unit is updated, the Digital Owner's Manual DVD must be in the workshop.

Instructions for installing Regio-DVDs can be found in the Support Tool on the "XENTRY KIT" or in the INFO information system on the Star Diagnosis System desktop.

Obtaining Software Using Regio-DVD and DVD Digital Owners' Manual

1. Check in EVA whether vehicle affected.
2. Update Software
3. A "XENTRY Kit" or a "Star Diagnosis compact" Performance as of System number 170000 is essential for the required diagnostic and programing measure (multiplexer with DoIP).
4. Regio DVD 07/20/2013 is required for software updates.
5. If earlier updates are needed, Update Regio DVD 05/2013 can be ordering in GLC/ELC.