	GROUP BOD	MODEL Sorento (XMa) 2011-2013MY
	NUMBER 093 (REV 3, 10/31/2014)	DATE February 2013

## TECHNICAL SERVICE BULLETIN

**SUBJECT:** SECOND ROW SEAT INOPERATIVE OR DIFFICULT TO RELEASE

### ★ NOTICE

**This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.**

This bulletin provides information related to some 2011-2013MY Sorento (XMa) vehicles, produced from October 26, 2009 to November 5, 2012, which may exhibit a concern related to the second row seats being inoperative or difficult to release. It is important to note that some amount of effort is required to fold the 2nd row seats. To correct this condition, follow the service procedure outlined in this TSB.



**File Under:** Body

---

**Circulate To:**   
 General Manager   
 Service Manager   
 Parts Manager  
 Service Advisors   
 Technicians   
 Body Shop Manager   
 Fleet Repair

**SUBJECT: SECOND ROW SEAT INOPERATIVE OR DIFFICULT TO RELEASE**

**SERVICE PROCEDURE:**

1. Operate the seatback reclining handle to verify excessive effort is required.


**\* NOTICE**

You may need to apply pressure to the seatback in order to free a jammed recliner mechanism.



Verify excessive effort required to operate handle.

2. To correct the concern on the RH side (40%) of the 2<sup>nd</sup> row seat, replace **both** inboard and outboard reclining mechanisms. Refer to KGIS > Body > Seat & Power Seat > Rear Seat > Repair Procedures, for specific repair procedures.

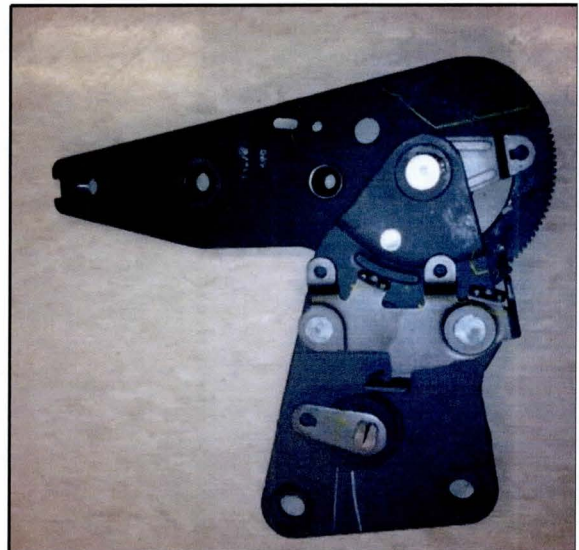

3. To correct the concern on the LH side (60%) of the 2<sup>nd</sup> row seat, replace the inboard reclining mechanism. Refer to KGIS > Body > Seat & Power Seat > Rear Seat > Repair Procedures, for specific repair procedures.

4. Confirm proper operation.

**SUBJECT: SECOND ROW SEAT INOPERATIVE OR DIFFICULT TO RELEASE**

## AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range
Sorento (XMa)	From October 26, 2009 to November 5, 2012

## WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty
W	89547 1U110	0	N92	C15	2 <sup>nd</sup> Row Seat Recliner and Cable Replacement (Right)	89690R0R	1.2 M/H	89547 1U251 H9 or 89547 1U251 J7 or 89547 1U251 VA	1
								89520 1U110 or 89620 2P210	1
								89620 2P220	1
W	89620 2P010	0	N92	C15	2 <sup>nd</sup> Row Seat Recliner and Cable Replacement (Left)	89690R00	1.5 M/H	89546 1U151 H9 or 89546 1U151 J7 or 89546 1U151 VA	1
								89620 2P010	1

**\* NOTICE**

Refer to EPC for correct application and part number.