



TECH TIP: Rear Parking Lights Stay On Intermittently

NUMBER: TT013

MODEL: 2006.5 - 2010MY Optima (MG)

DATE: 11/15/2013

Symptom: Rear parking lights stay on intermittently.

Repair: Inspect the tail lamp relay for intermittent sticking. Check for tail lamp ON ground signal to IPM from BCM. If ground is not present at the IPM, but tail lamps remain on, internal tail lamp relay is sticking and entire IPM requires replacement.

Note: Tech Tips are not a substitute for proper diagnosis.