Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2013 Mazda Motor of America, Inc.

Subject:

DOOR MIRROR BASE COVER DISCOLORATION


Last Issued: 04/04/2013

APPLICABLE MODEL(S)/VINS

2013 CX-5 vehicles with VINs lower than JM3KE*****138997 (produced July 24, 2012)

DESCRIPTION

Some vehicles may experience a discoloration (from black to white) of the outer door mirror base cover. The material used for the mirror base cover has been changed to eliminate this concern.

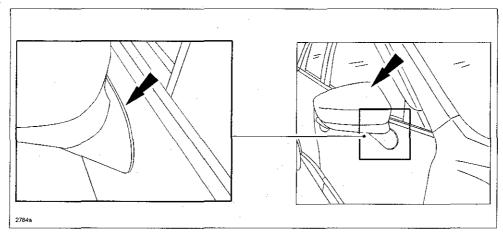

Customers having this concern should have their vehicle repaired using the following repair procedure.

Page 1 of 10

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical—including photocopying and recording and the use of any kind of information storage and retrieval system —without permission in particle.


Bulletin No: 09-009/13	Last Issued: 04/04/2013
© 2013 Mazda Motor of America, Inc.	

REPAIR PROCEDURE


1. Verify the customer concern.

NOTE:

- If this concern has occurred on one side, it is recommended that both sides be repaired, unless for some reason the outer mirror has already been replaced with a modified part.
- · Refer to the EPC for the modified door mirror part numbers.
- 2. Ensure the outer door mirrors are in the normal use (unfolded) position.
- 3. Remove the affected outer door mirror according to the instructions on MS3 online or the Workshop Manual (section 09-12 POWER OUTER MIRROR REMOVAL/INSTALLATION).
- 4. Remove the sealing rubber from the outer mirror base.

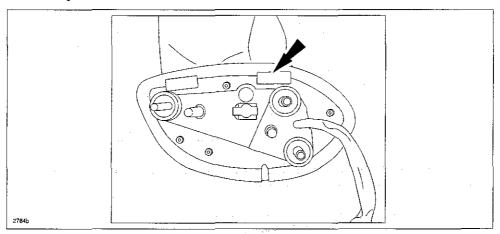


5. Using pliers, snap off the boss where the push nut (A) is installed, then remove it (B).

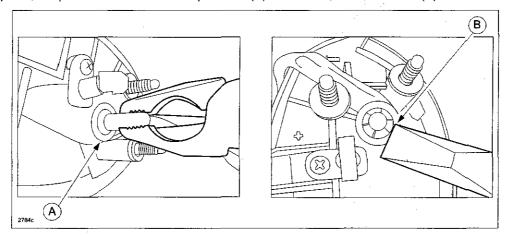


	[마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마마
	Bulletin No: 09-009/13 Last Issued: 04/04/2013
•	. 프로그는 그 사람들은 그들은 이번 그림을 하시는 것으로 가득하는 것이 되었다. 그런 그를 하는 것이 없는 그를 하는 것은 것이 되었다. 그는 것은 것은 것이 없는 것이 없다는 것이 없다는 것이 없다.
1 (2013 Mazda Motor of America, Inc.
1	하게 하는 사람이 되는 그들은 그를 마음을 잃었다. 하는 것이 나를 다고 있는 것이 되는 것이 되는 것이 되는 것이 되는 것이 없는 것이 없는 것이 없다.

6. Disconnect the four (4) connections shown below using a flathead screw driver.

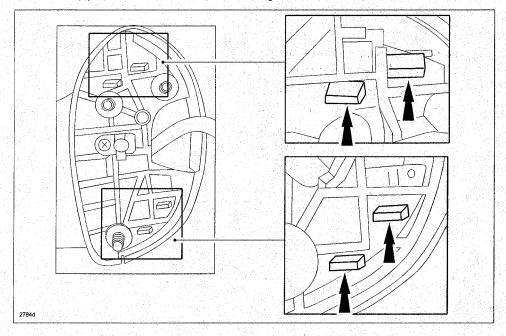


7. If the connection is disconnected, remove the cover by pulling it in the direction of the arrow shown below.

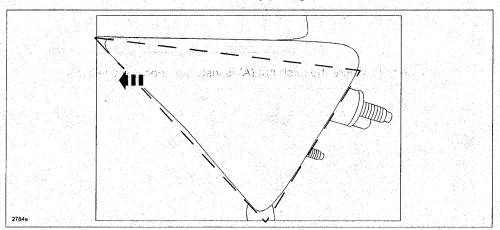


8. Replace the base cover with a new one.

		 	Landau Control
Bulletin No: 09-009/13		7	Last Issued: 04/04/2013
© 2013 Mazda Motor of America,	Inc.	100	

9. Remove the three (3) screws, then the upper base cover and inner base together. Remove the inner base passing the harness out of location (A).

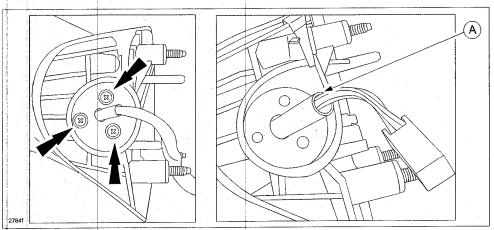


- (A) Inner Base (including Upper Base Cover)
 (B) Outer Mirror
 (C) Sealing Rubber
 (D) Lower Base Cover

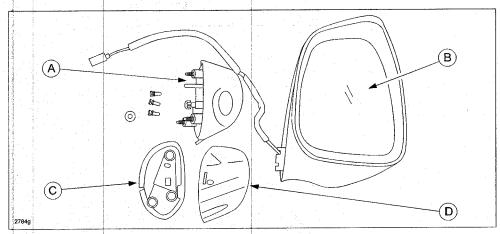

Bulletin No: 09-009/13	Last Issued: 04/04/2013
© 2013 Mazda Motor of America, Inc.	

10. Pass the harness through the new inner base.

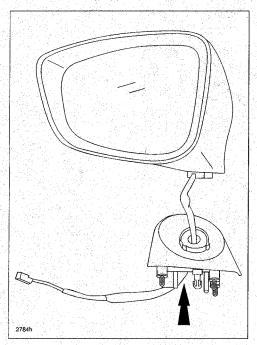


- 1		<u></u>		
	Bulletin No. 09-009/13		Last Issued: 04/04/2013	
- 1				
	© 2013 Mazda Motor of America, Inc.			

11. Install the inner base to the outer mirror matching up the positioning points.

- NOTE: Be careful not to pinch the harness.

 (A) Outer Mirror side


 (B) Inner Base side (including Upper Base Cover)

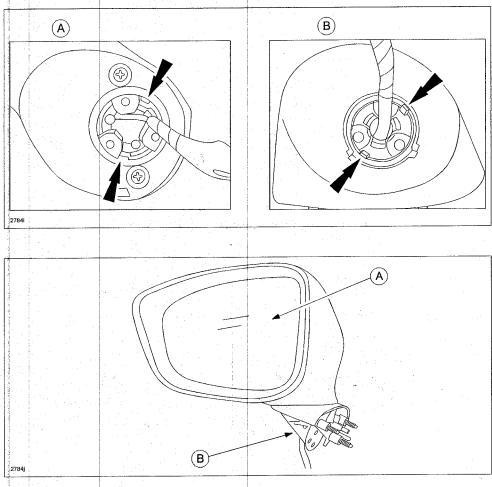


. 3		
	Bulletin No: 09-009/13	Last Issued: 04/04/2013
	, Bunetin No. 09-009/13	Last Issued: 04/04/2015
		學術한 문항에서 그렇게 지하는 뭐 뭐 하는 것이 하는 것이 나는 사람들이 되는 것이 되었다. 그는 그는 사람들이 되었다.
	C 2013 Mazda Motor of America, Inc.	▲ 100 Head Control Con

12. Install the inner base to the outer mirror using new screws (included in base cover set) using TORX screw (T25).

Tightening Torque: 47 +- 4 in•lbf (5.3 +- 0.5 N•m, 54 +- 5 kgf•cm)

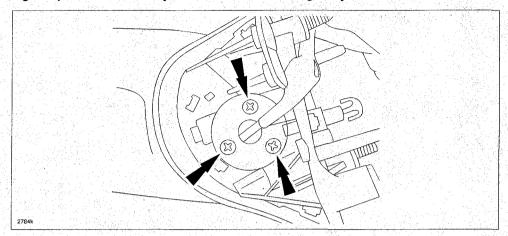


13. Push through the wire harness and install the new push nut (A) (included in base cover set) as shown below.

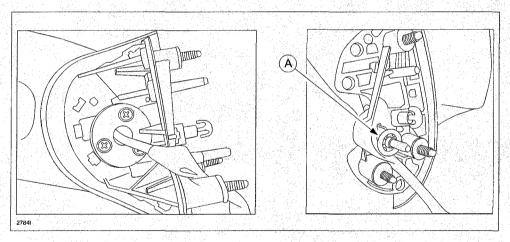


Bulletin No: 09-009/13 © 2013 Mazda Motor of America, Inc. Last Issued: 04/04/2013

14. Align both locators (A) and install the base cover to the inner base as shown below.

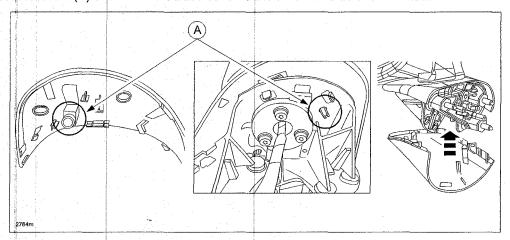

15. Confirm the harness length from the mirror base to the end of the connector is 340mm +- 10mm (A).


NOTE: If the harness is a two (2) connector type (with Rear View Monitor) (B), the position is 340mm from the shorter of the two (2) connectors.

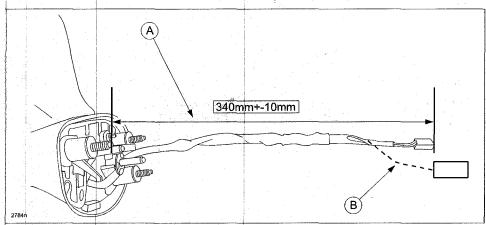

 Bulletin No:
 09-009/13
 Last issued:
 04/04/2013


 © 2013 Mazda Motor of America, Inc.
 Last issued:
 04/04/2013

16. Install the new sealing rubber (included in the base cover set) to the mirror base.

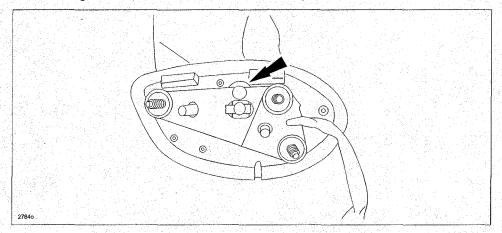

17. Remove the old EPT sealer from the harness and wrap a new one (included in the base cover set) in the same position (A), 140mm from the end of the connector.

NOTE: If the harness is a two (2) connector type (with Rear View Monitor) (B), the position is 140mm from the shorter of the two (2) connectors.

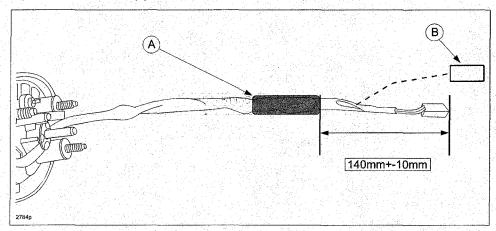

18. Install the outer door mirror according to the instructions on MS3 online or the Workshop Manual (section 09-12 POWER OUTER MIRROR REMOVAL/INSTALLATION).

NOTE: Replacement of mirror base and cover is identical on the opposite side outer door mirror.

19. Verify repair.

	1		
Bulletin No: 09-009/13		Last Issued: 04/04/2013	
© 2013 Mazda Motor of America, Inc.			

PART(S) INFORMATION

Part Number	Description		Qty.	Notes
KDY0-69-1A2	Base cover set (R)		1	·
KDY0-69-1A8	Base cover set (L)	, e s	1	

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type			A 200
Symptom Code			49
Damage Code			9X
Part Number Main Cause		[°] Kı	DY0-69-1A2 or KDY0-69-1A8
Quantity			1
Operation Number / Labor I	lours		(J4CXRX / 0.5 Hrs. (one side) J3ZXRX / 0.8 Hrs. (both sides)