



## TECH TIP: DTC - P0711 After Performing TSB TRA 040

NUMBER: TT027

MODEL: 2005-08 Sportage (KM)

DATE: 11/15/2013

**Symptom:** P0711 Trans Temp sensor reoccurs even after replacing the Trans Temp Sensor per TSB TRANS 040.

**Repair:** First, verify the transmission fluid is clean and full. Then, connect the GDS to the vehicle and verify the Trans Temp in "Trans Current Data". If temp is OK, the circuit is good from PCM to Trans for the temp sensor circuit. Inspect the pin tension at the Trans connector for the temp sensor circuit and TCM to confirm it is tight. Since the sensor was replaced already per TSB 040 and you have confirmed good pin tension at the connector, contact DPSM for Reman Trans replacement approval due to a faulty pigtail harness.

Note: Tech Tips are not a substitute for proper diagnosis.